Advanced Air Analysis, Inc.
P.O. BOX 525 OWINGS MILLS, MD 21117
Environmental & Industrial Hygiene Consultants
PHONE - (410) 653-7676 FAX - (410) 486-5200

August 14, 2025

Jane Lindenfelder
Bluebird Education Network
27 N. Lakewood Avenue,
Baltimore MD 21224

RE: "ST ELIZABETH CHURCH" AAA JOB #25528
2700 E BALTIMORE ST BALTIMORE, MARYLAND

ST ELIZABETH CHURCH – RENOVATION PROJECT: VISUAL INSPECTION, BULK SAMPLING & LABORATORY POLARIZED LIGHT MICROSCOPY (PLM) ANALYSIS OF CLIENT AND OWNER SELECTED MATERIALS SUSPECT TO CONTAIN ASBESTOS

Dear Ms. Lindenfelder:

On August 07, 2025, pursuant to your request, Advanced Air Analysis, Inc. (AAA), performed a visual inspection, bulk sampling and laboratory Polarized Light Microscopy (PLM) analysis of materials suspect to contain asbestos for the Renovation Project at the St Elizabeth Church located at 2700 E Baltimore St, Baltimore Maryland.

Mr. Carlos Rivera, and Industrial Hygienist (IH) with AAA, and accredited asbestos inspector, met with Bluebird Education Network Representative Mr. Bob Proutt, who escorted AAA the inspection areas. The following is a list of materials suspect to contain asbestos and selected for sampling.

Suspect Sampled Materials:

- 18" x 18" dark stone patterned floor tiles with gray adhesive
- 18" x 18" dark stone patterned floor tiles with yellow adhesive
- Brown layer between wood layers
- Ceramic tile grout
- 12" x 12" tan with dark streaks floor tile and adhesive
- 12" x 12" brown with white streaks floor tile and adhesive
- Green linoleum flooring with adhesive
- Yellow linoleum with adhesive under green linoleum
- Yellow linoleum with squares flooring and adhesive
- Brown floor tiles with mastic under yellow with squares linoleum flooring
- Brown stairs flooring and adhesive
- Gray rubber stair tread mastic
- 18" x 18" thin floor tiles with adhesive
- Cove base and tan adhesive
- Cove base and brown adhesive
- Terrazzo flooring
- Yellow carpet glue
- 12" x 12" Blue mottled floor tiles with adhesive
- Brown carpet glue
- 9" x 9" Red floor tiles with black mastic
- 9" x 9" Tan/gray floor tiles with black mastic
- Tile grout
- Black stairs flooring with adhesive
- Repair tiles: 12" x 12" tan mottled floor tiles with adhesive
- 9" x 9" Dark gray floor tiles with black mastic
- Yellow carpet glue(powder)
- Vapor barrier paper

- Gray floor leveler with black spots
- Fiberglass insulation Ductwork wrap with sealant
- Gray and white plaster walls
- Smooth plaster wall covering
- Textured plaster wall covering
- Brown and white plaster walls
- Plaster
- Black ductwork panel covering
- Drywall
- Joint compound
- Textured ceiling (popcorn ceiling)
- 2' x 4' ceiling tile with pinoles and pockmarks
- Plaster ceiling
- 2' x 2' textured ceiling tile with pinoles
- 2' x 4' ceiling tile with large gouges and pockmarks
- Brown pipe wrap with adhesive
- Stained window glazing (interior)
- Stained window glazing (exterior)
- Stained window frame caulking (exterior)

Assumed ACM:

- Layers of flooring beneath hardwood flooring in the first level.
- Pipe fitting/elbow in wall cavities throughout the building
- Cabinetry/Casework mounting adhesive
- High ceilings in First and Second level areas
- West chapel office – inaccessible during inspection

BULK SAMPLING & LABORATORY "PLM" ANALYSIS

Samples of suspect ACM were collected and then placed in "zip lock" bags and assigned unique identifiers, which were recorded on the bag and the bulk survey sampling sheets. Samples were submitted to EMSL Analytical Services, Inc. of Beltsville, Maryland. EMSL Analytical, Inc. participates in the U.S. Department of Commerce, National Institute of Standards and Technology through the National Voluntary Laboratory Accreditation Program (NVLAP) for Bulk Asbestos Analysis and accredited by the American Industrial Hygiene Association. Samples of bulk material were analyzed using polarized light microscopy (PLM) following the EPA Method 600/R-93/116. PLM is an optical microscopic technique used to distinguish the different types of asbestos fibers by their shape and unique optical properties. The technique is based on observing the refraction of light from the various crystalline asbestos structures and identifying the corresponding color changes through the microscope. PLM analysis of bulk samples which indicate results of greater than 1% asbestos classify the material as asbestos containing according to the EPA.

Three (3) bulk samples were collected per homogeneous area (type of materials) from all suspect ACM (except plaster which was sampled following the 3-5-7 rule). Total of One Hundred Forty-Six (146) bulk samples were collected and submitted for laboratory Polarized Light Microscopy (PLM) analysis to EMSL Analytical, Inc., a laboratory accredited by the National Voluntary Accreditation Program (NVLAP) for identification of asbestos in bulk materials. In multi-layer samples (such as skim coat and rough coat of plaster) each layer was analyzed, and result reported separately. Positive Stop procedures were implemented during analysis. A total of One Hundred Ninety-Nine (199) bulk samples were analyzed. For samples results and locations please see the following table:

"PLM" ASBESTOS BULK SAMPLE RESULT
ST ELIZABETH CHURCH
2700 E BALTIMORE ST BALTIMORE, MARYLAND

SAMPLE #	MATERIAL	LOCATION	ASBESTOS %, TYPE
25528-080725-01	18" x 18" dark stone patterned floor tiles	Lower Lever – parish hall stair area	None Detected
25528-080725-02		Lower Lever – parish hall stair area	None Detected
25528-080725-03		Lower Lever – parish hall stair area	None Detected
25528-080725-01A	Gray adhesive under 18" x 18" dark stone patterned floor tiles	Lower Lever – parish hall stair area	None Detected
25528-080725-02A		Lower Lever – parish hall stair area	None Detected
25528-080725-03A		Lower Lever – parish hall stair area	None Detected

SAMPLE #	MATERIAL	LOCATION	ASBESTOS %, TYPE
25528-080725-04	18” x 18” dark stone patterned floor tiles	Lower Lever – parish hall main seating area outside restroom	None Detected
25528-080725-05		Lower Lever – parish hall main seating area second column from restroom	None Detected
25528-080725-06		Lower Lever – parish hall main seating area column in front of stage	None Detected
25528-080725-04A	Yellow adhesive under 18” x 18” dark stone patterned floor tiles	Lower Lever – parish hall main seating area outside restroom	None Detected
25528-080725-05A		Lower Lever – parish hall main seating area second column from restroom	None Detected
25528-080725-06A		Lower Lever – parish hall main seating area column in front of stage	None Detected
25528-080725-07	Brown layer between wood layers	Lower Level – parish hall outside men’s restroom	None Detected
25528-080725-08		Lower Level – center of parish hall	None Detected
25528-080725-09		Lower Level – parish hall outside of kitchen	None Detected
25528-080725-10	Ceramic tile grout	Lower Level – parish hall side kitchen/bar	None Detected
25528-080725-11		Lower Level – parish hall men’s restroom	None Detected
25528-080725-12		Lower Level – parish hall women’s. restroom	None Detected
25528-080725-13	12” x 12” tan with dark streaks floor tile	Lower Level – parish hall stage	None Detected
25528-080725-14		Lower Level – parish hall stage	None Detected
25528-080725-15		Lower Level – parish hall stage	None Detected
25528-080725-13A	Adhesive under 12” x 12” tan with dark streaks floor tile	Lower Level – parish hall stage	None Detected
25528-080725-14A		Lower Level – parish hall stage	None Detected
25528-080725-15A		Lower Level – parish hall stage	None Detected
25528-080725-16	**12” x 12” brown with white streaks floor tile**	Lower Level – parish hall stage	None Detected
25528-080725-17		**Lower Level – parish hall stage**	**2% Chrysotile**
25528-080725-18		Lower Level – parish hall stage	Positive Stop
25528-080725-16A	Adhesive under 12” x 12” brown with white streaks floor tile	Lower Level – parish hall stage	None Detected
25528-080725-17A		Lower Level – parish hall stage	None Detected
25528-080725-18A		Lower Level – parish hall stage	None Detected
25528-080725-19	Green linoleum flooring with adhesive	Lower Level – parish hall kitchen	None Detected
25528-080725-20		Lower Level – parish hall kitchen	None Detected
25528-080725-21		Lower Level – parish hall kitchen	None Detected
25528-080725-19A	Adhesive under Green linoleum flooring	Lower Level – parish hall kitchen	None Detected
25528-080725-20A		Lower Level – parish hall kitchen	None Detected
25528-080725-21A		Lower Level – parish hall kitchen	None Detected
25528-080725-22	Yellow linoleum floor under green linoleum floor	Lower Level – parish hall kitchen	None Detected
25528-080725-23		Lower Level – parish hall kitchen	None Detected
25528-080725-24		Lower Level – parish hall kitchen	None Detected
25528-080725-22A	Adhesive under Yellow linoleum floor under green linoleum floor	Lower Level – parish hall kitchen	None Detected
25528-080725-23A		Lower Level – parish hall kitchen	None Detected
25528-080725-24A		Lower Level – parish hall kitchen	None Detected
25528-080725-25	**Yellow linoleum with squares flooring**	**Lower Level – parish hall storage room of kitchen / mech room**	**35% Chrysotile**
25528-080725-26		Lower Level – parish hall storage room of kitchen / mech room	Positive Stop
25528-080725-27		Lower Level – parish hall storage room of kitchen / mech room	Positive Stop
25528-080725-25A	Adhesive under Yellow linoleum with squares flooring	Lower Level – parish hall storage room of kitchen / mech room	None Detected
25528-080725-26A		Lower Level – parish hall storage room of kitchen / mech room	None Detected
25528-080725-27A		Lower Level – parish hall storage room of kitchen / mech room	None Detected
25528-080725-28	**Brown floor tiles with mastic under yellow**	**Lower Level – parish hall storage room of kitchen / mech room**	**6% Chrysotile**

SAMPLE #	MATERIAL	LOCATION	ASBESTOS %, TYPE
25528-080725-29	**with squares linoleum flooring**	Lower Level – parish hall storage room of kitchen / mech room	Positive Stop
25528-080725-30		Lower Level – parish hall storage room of kitchen / mech room	Positive Stop
25528-080725-28A	**Mastic under Brown floor tiles under yellow with squares linoleum flooring**	**Lower Level – parish hall storage room of kitchen / mech room**	**5% Chrysotile**
25528-080725-29A		Lower Level – parish hall storage room of kitchen / mech room	Positive Stop
25528-080725-30A		Lower Level – parish hall storage room of kitchen / mech room	Positive Stop
25528-080725-31	Brown stairs flooring	Lower Level – parish hall storage room of kitchen / mech room	None Detected
25528-080725-32		Lower Level – parish hall storage room of kitchen / mech room	None Detected
25528-080725-33		Lower Level – parish hall storage room of kitchen / mech room	None Detected
25528-080725-31A	Adhesive under Brown stairs flooring	Lower Level – parish hall storage room of kitchen / mech room	None Detected
25528-080725-32A		Lower Level – parish hall storage room of kitchen / mech room	None Detected
25528-080725-33A		Lower Level – parish hall storage room of kitchen / mech room	None Detected
25528-080725-34	Gray rubber stair tread mastic	Lower Level – parish hall center stairs landing	None Detected
25528-080725-35		Lower Level – parish hall center stairs landing	None Detected
25528-080725-36		Lower Level – parish hall center stairs	None Detected
25528-080725-37	18” x 18” thin floor tiles with adhesive	Lower level – parish hall center of space	None Detected
25528-080725-38		Lower level – parish hall center of space	None Detected
25528-080725-39		Lower level – parish hall center of space	None Detected
25528-080725-37A	Adhesive under 18” x 18” thin floor tiles	Lower level – parish hall center of space	None Detected
25528-080725-38A		Lower level – parish hall center of space	None Detected
25528-080725-39A		Lower level – parish hall center of space	None Detected
25528-080725-40	Cove base	Lower Level – parish hall outside of side kitchen/bar	None Detected
25528-080725-41		Lower Level – parish hall outside of men’s restroom	None Detected
25528-080725-42		Lower level – parish hall center of space on column	None Detected
25528-080725-40A	Tan adhesive behind Cove base	Lower Level – parish hall outside of side kitchen/bar	None Detected
25528-080725-41A		Lower Level – parish hall outside of men’s restroom	None Detected
25528-080725-42A		Lower level – parish hall center of space on column	None Detected
25528-080725-43	Cove base	Lower Level – parish hall side kitchen/bar	None Detected
25528-080725-44		Lower Level – parish hall side kitchen/bar	None Detected
25528-080725-45		Lower Level – parish hall side kitchen/bar	None Detected
25528-080725-43A	Brown adhesive behind Cove base	Lower Level – parish hall side kitchen/bar	None Detected
25528-080725-44A		Lower Level – parish hall side kitchen/bar	None Detected
25528-080725-45A		Lower Level – parish hall side kitchen/bar	None Detected
25528-080725-46	Terrazzo flooring	First Level – south entrance corridor	None Detected
25528-080725-47		First Level – south entrance corridor	None Detected
25528-080725-48		First Level – south entrance corridor	<1% Chrysotile
25528-080725-49	Yellow carpet glue	First Level – south entrance corridor	None Detected
25528-080725-50		First Level – south entrance corridor	None Detected
25528-080725-51		First Level – south entrance corridor	None Detected
25528-080725-52	12” x 12” Blue mottled floor	First Level – chapel	None Detected
25528-080725-53		First Level – chapel	None Detected

SAMPLE #	MATERIAL	LOCATION	ASBESTOS %, TYPE
25528-080725-54		Second Level – organ/piano room	None Detected
25528-080725-52A	Adhesive under 12” x 12” Blue mottled floor tiles	First Level – chapel	None Detected
25528-080725-53A		First Level – chapel	None Detected
25528-080725-54A		Second Level – organ/piano room	None Detected
25528-080725-55	Brown carpet glue	First Level – alter carpet	None Detected
25528-080725-56		First Level – alter carpet	None Detected
25528-080725-57		First Level – alter carpet	None Detected
25528-080725-58	9” x 9” Red floor tiles	First Level – chapel east office	None Detected
25528-080725-59		First Level – chapel east office	None Detected
25528-080725-60		First Level – chapel east office	None Detected
25528-080725-58A	Black mastic and felt paper under 9” x 9” Red floor tiles	First Level – chapel east office	None Detected
25528-080725-59A		First Level – chapel east office	None Detected
25528-080725-60A		First Level – chapel east office	None Detected
25528-080725-61	9” x 9” Tan/gray floor tiles	First Level – chapel east office	None Detected
25528-080725-62		First Level – chapel east office	None Detected
25528-080725-63		First Level – chapel east office	None Detected
25528-080725-61A	Black mastic and felt paper under 9” x 9” Tan/gray floor tiles	First Level – chapel east office	None Detected
25528-080725-62A		First Level – chapel east office	None Detected
25528-080725-63A		First Level – chapel east office	None Detected
25528-080725-64	Tile grout	First Level – chapel alter east	None Detected
25528-080725-65		First Level – chapel alter north	None Detected
25528-080725-66		First Level – chapel alter west	None Detected
25528-080725-67	Black stairs flooring with adhesive	First Level – south entrance stairs to second floor	None Detected
25528-080725-68		First Level – south entrance stairs to second floor	None Detected
25528-080725-69		First Level – south entrance stairs to second floor	None Detected
25528-080725-67A	Adhesive under Black stairs flooring	First Level – south entrance stairs to second floor	None Detected
25528-080725-68A		First Level – south entrance stairs to second floor	None Detected
25528-080725-69A		First Level – south entrance stairs to second floor	None Detected
25528-080725-70	**Repair tiles: 12” x 12” tan mottled floor tiles**	**Second Level - organ/piano room**	**4% Chrysotile**
25528-080725-71		Second Level - organ/piano room	Positive Stop
25528-080725-72		Second Level - organ/piano room	Positive Stop
25528-080725-70A	Adhesive under Repair tiles: 12” x 12” tan mottled floor tiles	Second Level - organ/piano room	None Detected
25528-080725-71A		Second Level - organ/piano room	None Detected
25528-080725-72A		Second Level - organ/piano room	None Detected
25528-080725-73	**9” x 9” Dark gray floor tiles**	**Second Level - organ/piano room**	**13% Chrysotile**
25528-080725-74		Second Level - organ/piano room	Positive Stop
25528-080725-75		Second Level - organ/piano room	Positive Stop
25528-080725-73A	**Black mastic under 9” x 9” Dark gray floor tiles**	**Second Level - organ/piano room**	**4% Chrysotile**
25528-080725-74A		Second Level - organ/piano room	Positive Stop
25528-080725-75A		Second Level - organ/piano room	Positive Stop
25528-080725-76	Yellow carpet glue(powder)	Second Level - organ/piano room	None Detected
25528-080725-77		Second Level - organ/piano room	None Detected
25528-080725-78		Second Level - organ/piano room	None Detected
25528-080725-79	Vapor barrier paper	Second Level – room next to organ/piano room	None Detected
25528-080725-80		Second Level – room next to organ/piano room	None Detected
25528-080725-81		Second Level – room next to organ/piano room	None Detected
25528-080725-82	Gray floor leveler with black spots	Second Level – room next to organ/piano room	None Detected
25528-080725-83		Second Level – room next to organ/piano room	None Detected

SAMPLE #	MATERIAL	LOCATION	ASBESTOS %, TYPE
25528-080725-84		Second Level – room next to organ/piano room	None Detected
25528-080725-85	Fiberglass insulation Ductwork wrap with sealant	Second Level – room next to organ/piano room	None Detected
25528-080725-86		Second Level – room next to organ/piano room	None Detected
25528-080725-87		Second Level – room next to organ/piano room	None Detected
25528-080725-88	Gray and white plaster walls (Skim coats)	Second Level - organ/piano room	None Detected
25528-080725-89		Second Level – room next to organ/piano room	None Detected
25528-080725-90		First Level – west side chapel	None Detected
25528-080725-91		First Level – east side chapel office	None Detected
25528-080725-92		Lower Level – outside parish hall at east wall	None Detected
25528-080725-93		Lower Level – outside parish hall at west wall	None Detected
25528-080725-94		Lower level – parish hall area outside women's restroom	None Detected
25528-080725-88A	Gray and white plaster walls (Rough coats)	Second Level - organ/piano room	None Detected
25528-080725-89A		Second Level – room next to organ/piano room	None Detected
25528-080725-90A		First Level – west side chapel	None Detected
25528-080725-91A		First Level – east side chapel office	None Detected
25528-080725-92A		Lower Level – outside parish hall at east wall	None Detected
25528-080725-93A		Lower Level – outside parish hall at west wall	None Detected
25528-080725-94A		Lower level – parish hall area outside women's restroom	None Detected
25528-080725-95	Smooth plaster wall covering	First Level – west side chapel	None Detected
25528-080725-96		First Level – west side chapel	None Detected
25528-080725-97		First Level – east side chapel	None Detected
25528-080725-98	Textured plaster wall covering	First Level – east side chapel office	None Detected
25528-080725-99		First Level – east side chapel office	None Detected
25528-080725-100		First Level – east side chapel office	None Detected
25528-080725-101	Brown and white plaster walls (Skim coats)	First Level – east side chapel next to statue	None Detected
25528-080725-102		First Level – east side chapel next to statue	None Detected
25528-080725-103		Lower Level – east wall	None Detected
25528-080725-104		Lower Level – east wall	None Detected
25528-080725-105		Lower Level – west wall	None Detected
25528-080725-106		Lower Level – west wall	None Detected
25528-080725-107		Lower Level – west wall	None Detected
25528-080725-101A	Brown and white plaster walls (Rough coats)	First Level – east side chapel next to statue	None Detected
25528-080725-102A		First Level – east side chapel next to statue	None Detected
25528-080725-103A		Lower Level – east wall	None Detected
25528-080725-104A		Lower Level – east wall	None Detected
25528-080725-105A		Lower Level – west wall	None Detected
25528-080725-106A		Lower Level – west wall	None Detected
25528-080725-107A		Lower Level – west wall	None Detected
25528-080725-108	Plaster (Skim coat only)	Lower level – columns	None Detected
25528-080725-109		Lower level – columns	None Detected
25528-080725-110		Lower level – columns	None Detected
25528-080725-111	Black ductwork panel covering	Lower level – next to women's restroom	None Detected
25528-080725-112		Lower level – next to women's restroom	None Detected
25528-080725-113		Lower level – next to women's restroom	None Detected
25528-080725-114	Drywall	Lower level – storage room between kitchen and mech room	None Detected
25528-080725-115		Lower level – men's restroom	None Detected

SAMPLE #	MATERIAL	LOCATION	ASBESTOS %, TYPE
25528-080725-116		First Level – chapel east office	None Detected
25528-080725-117	Joint compound	Lower level – storage room between kitchen and mech room	None Detected
25528-080725-118		Lower level – men's restroom	None Detected
25528-080725-119		First Level – chapel east office	None Detected
25528-080725-120	Textured ceiling (popcorn ceiling)	First Level – south entrance corridor	None Detected
25528-080725-121		First Level – south entrance corridor	None Detected
25528-080725-122		First Level – south entrance corridor	None Detected
25528-080725-123	2' x 4' ceiling tile with pinoles and pockmarks	First Level – chapel east office	None Detected
25528-080725-124		First Level – chapel east office	None Detected
25528-080725-125		First Level – chapel east office	None Detected
25528-080725-126	Plaster ceiling (Skim coats)	First Level – chapel east office	None Detected
25528-080725-127		First Level – chapel east office	None Detected
25528-080725-128		First Level – chapel east office	None Detected
25528-080725-126A	Plaster ceiling (Rough coats)	First Level – chapel east office	None Detected
25528-080725-127A		First Level – chapel east office	None Detected
25528-080725-128A		First Level – chapel east office	None Detected
25528-080725-129	2' x 2' textured ceiling tile with pinoles	Lower level – women's restroom	None Detected
25528-080725-130		Lower level – women's restroom	None Detected
25528-080725-131		Lower level – women's restroom	None Detected
25528-080725-132	2' x 4' ceiling tile with large gouges and pockmarks	Lower level – outside parish hall	None Detected
25528-080725-133		Lower Level – above women's restroom drop ceiling	None Detected
25528-080725-134		Lower Level – parish hall	None Detected
25528-080725-135	Brown pipe wrap with adhesive	Lower Level – above women's restroom drop ceiling	None Detected
25528-080725-136		Lower Level – above women's restroom drop ceiling	None Detected
25528-080725-137		Lower Level – above women's restroom drop ceiling	None Detected
25528-080725-138	Stained window glazing (interior)	First Level – west wall (accessible working window)	None Detected
25528-080725-139		First Level – west wall (accessible working window)	None Detected
25528-080725-140		First Level – west wall (accessible working window)	None Detected
25528-080725-141	**Stained window glazing (exterior)**	**First Level – west wall (accessible working window)**	**3% Chrysotile**
25528-080725-142		First Level – west wall (accessible working window)	Positive Stop
25528-080725-143		First Level – west wall (accessible working window)	Positive Stop
25528-080725-144	**Stained window frame caulking (exterior)**	**First Level – west wall (accessible working window)**	**15% Chrysotile**
25528-080725-145		First Level – west wall (accessible working window)	Positive Stop
25528-080725-146		First Level – west wall (accessible working window)	Positive Stop

Based on a laboratory analysis results, the following materials were found to contain greater than 1% asbestos and therefor are asbestos containing materials.

- **12" x 12" brown with white streaks floor tile**
- **Yellow linoleum with squares flooring**
- **Brown floor tiles and mastic under yellow with squares linoleum flooring**
- **Repair tiles: 12" x 12" tan mottled floor tiles**
- **9" x 9" Dark gray floor tiles and associated black mastic**
- **Stained window glazing (exterior)**
- **Stained window frame caulking (exterior)**

It is not possible to visibly differentiate the different types of black mastic therefor all black mastic should be treated as an asbestos containing material

The following materials are Assumed to contain asbestos and should be treated as Asbestos Containing Materials until sampled for asbestos content:

- Layers of flooring beneath hardwood flooring in the first level.
- Pipe fitting/elbow in wall cavities throughout the building
- Cabinetry/Casework mounting adhesive
- High ceilings in First and Second level areas
- West chapel office – inaccessible during inspection

During Laboratory analysis of sample # 25528-080725-48, EMSL Analytical made the following comments "Lizardite crystals(non-fibrous form of the serpentine chrysotile) were found in this sample. They could become, potentially, hazardous if they are crushed and pulverized: thus, fibrous in nature." AAA spoke with the client and made the recommendation to upgrade Sample # 25528-080725-48 to Transmission Electron Microscopy (TEM). The client chose to perform this testing at a later date.

All asbestos abatement work should be performed under full negative pressure containment by the State of Maryland licensed asbestos abatement contractor following all applicable federal and State of Maryland asbestos abatement regulations, and asbestos abatement requirements. Abatement oversight and air monitoring should be performed by independent Industrial Hygiene (IH) firm.

If any unforeseen suspect ACM is discovered, it should be tested for asbestos content or removed as an asbestos containing material. In addition, asbestos pipe/elbows may exist in inaccessible areas of the building structures, such as above fixed plaster/drywall ceiling and in hidden wall, ceiling, behind sinks, walls in restrooms, and other areas. As these building structures are made accessible for renovation purposes, hidden asbestos containing materials (ACM) may be discovered. Before opening, drilling, sawing, demolishing, or otherwise accessing any of these building structures, the Contractor shall seal all access doors to the room or erect poly barriers at entrance to each restroom to isolate work area in the event of unforeseen discovery of friable ACM when the concealed building structure is accessed. AAA recommends performing demolition of such structures by a licensed asbestos abatement contractor with independent IH firm representative who can recognize potential disturbance of ACM.

Enclosed with this letter report please find a copy of daily log, chain of custody and laboratory analysis result for this project. Should you have any questions regarding the report or sample result, please do not hesitate to contact me at (410) 653-7676.

Sincerely,

Leon Fridman,
Project Manager

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Asbestos Chain of Custody

EMSL Order Number *(Lab Use Only)*: 192506218

PHONE:
FAX:

Company Name: Advanced Air Analysis, Inc		**EMSL Customer ID:**	
Street: 11 Warren Road		**City:** Baltimore	**State/Province:** MD
Zip/Postal Code: 21208	**Country:** USA	**Telephone #:** 410-653-7676	**Fax #:** 410-486-5200
Report To (Name): Alexander Fridman		**Please Provide Results:** ☐ Fax ☑ Email	
Email Address: results@aaanalysis.com		**Purchase Order:**	
Project Name/Number: St Elizabeth Church / 25528		**EMSL Project ID** *(Internal Use Only)*:	
U.S. State Samples Taken:		**CT Samples:** ☐ Commercial/Taxable ☐ Residential/Tax Exempt	

EMSL-Bill to: ☑ Same ☐ Different - If Bill to is Different note instructions in Comments**
Third Party Billing requires written authorization from third party

Turnaround Time (TAT) Options* – Please Check

☐ 3 Hour	☐ 6 Hour	☐ 24 Hour	☐ 48 Hour	☑ 72 Hour	☐ 96 Hour	☐ 1 Week	☐ 2 Week

*For TEM Air 3 hr through 6 hr, please call ahead to schedule.*There is a premium charge for 3 Hour TEM AHERA or EPA Level II TAT. You will be asked to sign an authorization form for this service. Analysis completed in accordance with EMSL's Terms and Conditions located in the Analytical Price Guide.*

PCM - Air ☐ Check if samples are from NY
- ☐ NIOSH 7400
- ☐ w/ OSHA 8hr. TWA

PLM - Bulk (reporting limit)
- ☑ PLM EPA 600/R-93/116 (<1%)
- ☐ PLM EPA NOB (<1%)

Point Count
- ☐ 400 (<0.25%) ☐ 1000 (<0.1%)

Point Count w/Gravimetric
- ☐ 400 (<0.25%) ☐ 1000 (<0.1%)
- ☐ NYS 198.1 (friable in NY)
- ☐ NYS 198.6 NOB (non-friable-NY)
- ☐ NYS 198.8 SOF-V
- ☐ NIOSH 9002 (<1%)

TEM – Air ☐ **4-4.5hr TAT** (AHERA only)
- ☐ AHERA 40 CFR, Part 763
- ☐ NIOSH 7402
- ☐ EPA Level II
- ☐ ISO 10312

TEM - Bulk
- ☐ TEM EPA NOB
- ☐ NYS NOB 198.4 (non-friable-NY)
- ☐ Chatfield SOP
- ☐ TEM Mass Analysis-EPA 600 sec. 2.5

TEM – Water: EPA 100.2
- Fibers >10µm ☐ Waste ☐ Drinking
- All Fiber Sizes ☐ Waste ☐ Drinking

TEM- Dust
- ☐ Microvac - ASTM D 5755
- ☐ Wipe - ASTM D6480
- ☐ Carpet Sonication (EPA 600/J-93/167)

Soil/Rock/Vermiculite
- ☐ PLM EPA 600/R-93/116 with milling prep (<1%)
- ☐ PLM EPA 600/R-93/116 with milling prep (<0.25%)
- ☐ TEM EPA 600/R-93/116 with milling prep (<0.1%)
- ☐ TEM Qualitative via Filtration Prep
- ☐ TEM Qualitative via Drop Mount Prep
- ☐ Cincinnati Method EPA 600/R-04/004 – PLM/TEM (BC only)

Other: ☐

☑ **Check For Positive Stop – Clearly Identify Homogenous Group**

Filter Pore Size (Air Samples): ☐ 0.8µm ☐ 0.45µm

Samplers Name: Carlos Rivera

Samplers Signature:

Sample #	Sample Description	Volume/Area (Air) HA # (Bulk)	Date/Time Sampled
	See Attached		08/07/25

Client Sample # (s): 25528-080725-01 - 25528-080725-146 **Total # of Samples:** 146

Relinquished (Client): **Date:** 08/07/25 **Time:**

Received (Lab): L. Haworth Drop Box **Date:** 8/8/25 **Time:** 8:35am

Comments/Special Instructions:

Controlled Document – Asbestos COC – R10 – 05/09/2016

192506218

ASBESTOS BULK SAMPLING FORM
St Elizabeth Church
2700 E Baltimore St Baltimore, Maryland
AAA 25528

Sample #	Material	Location
25528-080725-01	18" x 18" dark stone patterned floor tiles with gray adhesive	Lower Lever – parish hall stair area
25528-080725-02		Lower Lever – parish hall stair area
25528-080725-03		Lower Lever – parish hall stair area
25528-080725-04	18" x 18" dark stone patterned floor tiles with yellow adhesive	Lower Lever – parish hall main seating area outside restroom
25528-080725-05		Lower Lever – parish hall main seating area second column from restroom
25528-080725-06		Lower Lever – parish hall main seating area column in front of stage
25528-080725-07	Brown layer between wood layers	Lower Level – parish hall outside men's restroom
25528-080725-08		Lower Level – center of parish hall
25528-080725-09		Lower Level – parish hall outside of kitchen
25528-080725-10	Ceramic tile grout	Lower Level – parish hall side kitchen/bar
25528-080725-11		Lower Level – parish hall men's restroom
25528-080725-12		Lower Level – parish hall women's. restroom
25528-080725-13	12" x 12" tan with dark streaks floor tile and adhesive	Lower Level – parish hall stage
25528-080725-14		Lower Level – parish hall stage
25528-080725-15		Lower Level – parish hall stage
25528-080725-16	12" x 12" brown with white streaks floor tile and adhesive	Lower Level – parish hall stage
25528-080725-17		Lower Level – parish hall stage
25528-080725-18		Lower Level – parish hall stage
25528-080725-19	Green linoleum flooring with adhesive	Lower Level – parish hall kitchen
25528-080725-20		Lower Level – parish hall kitchen
25528-080725-21		Lower Level – parish hall kitchen
25528-080725-22	Yellow linoleum with adhesive under green linoleum	Lower Level – parish hall kitchen
25528-080725-23		Lower Level – parish hall kitchen
25528-080725-24		Lower Level – parish hall kitchen
25528-080725-25	Yellow linoleum with squares flooring and adhesive	Lower Level – parish hall storage room of kitchen / mech room
25528-080725-26		Lower Level – parish hall storage room of kitchen / mech room
25528-080725-27		Lower Level – parish hall storage room of kitchen / mech room
25528-080725-28	Brown floor tiles with mastic under yellow with squares linoleum flooring	Lower Level – parish hall storage room of kitchen / mech room
25528-080725-29		Lower Level – parish hall storage room of kitchen / mech room
25528-080725-30		Lower Level – parish hall storage room of kitchen / mech room
25528-080725-31	Brown stairs flooring and adhesive	Lower Level – parish hall storage room of kitchen / mech room
25528-080725-32		Lower Level – parish hall storage room of kitchen / mech room
25528-080725-33		Lower Level – parish hall storage room of kitchen / mech room
25528-080725-34	Gray rubber stair tread mastic	Lower Level – parish hall center stairs landing
25528-080725-35		Lower Level – parish hall center stairs landing
25528-080725-36		Lower Level – parish hall center stairs
25528-080725-37	18" x 18" thin floor tiles with adhesive	Lower level – parish hall center of space
25528-080725-38		Lower level – parish hall center of space
25528-080725-39		Lower level – parish hall center of space
25528-080725-40	Cove base and tan adhesive	Lower Level – parish hall outside of side kitchen/bar
25528-080725-41		Lower Level – parish hall outside of men's restroom
25528-080725-42		Lower level – parish hall center of space on column
25528-080725-43	Cove base and brown adhesive	Lower Level – parish hall side kitchen/bar
25528-080725-44		Lower Level – parish hall side kitchen/bar
25528-080725-45		Lower Level – parish hall side kitchen/bar
25528-080725-46	Terrazzo flooring	First Level – south entrance corridor
25528-080725-47		First Level – south entrance corridor

192506218

Sample #	Material	Location
25528-080725-48		First Level – south entrance corridor
25528-080725-49	Yellow carpet glue	First Level – south entrance corridor
25528-080725-50		First Level – south entrance corridor
25528-080725-51		First Level – south entrance corridor
25528-080725-52	12" x 12" Blue mottled floor tiles with adhesive	First Level – chapel
25528-080725-53		First Level – chapel
25528-080725-54		Second Level – organ/piano room
25528-080725-55	Brown carpet glue	First Level – alter carpet
25528-080725-56		First Level – alter carpet
25528-080725-57		First Level – alter carpet
25528-080725-58	9" x 9" Red floor tiles with black mastic	First Level – chapel east office
25528-080725-59		First Level – chapel east office
25528-080725-60		First Level – chapel east office
25528-080725-61	9" x 9" Tan/gray floor tiles with black mastic	First Level – chapel east office
25528-080725-62		First Level – chapel east office
25528-080725-63		First Level – chapel east office
25528-080725-64	Tile grout	First Level – chapel alter east
25528-080725-65		First Level – chapel alter north
25528-080725-66		First Level – chapel alter west
25528-080725-67	Black stairs flooring with adhesive	First Level – south entrance stairs to second floor
25528-080725-68		First Level – south entrance stairs to second floor
25528-080725-69		First Level – south entrance stairs to second floor
25528-080725-70	Repair tiles: 12" x 12" tan mottled floor tiles with adhesive	Second Level - organ/piano room
25528-080725-71		Second Level - organ/piano room
25528-080725-72		Second Level - organ/piano room
25528-080725-73	9" x 9" Dark gray floor tiles with black mastic	Second Level - organ/piano room
25528-080725-74		Second Level - organ/piano room
25528-080725-75		Second Level - organ/piano room
25528-080725-76	Yellow carpet glue(powder)	Second Level - organ/piano room
25528-080725-77		Second Level - organ/piano room
25528-080725-78		Second Level - organ/piano room
25528-080725-79	Vapor barrier paper	Second Level – room next to organ/piano room
25528-080725-80		Second Level – room next to organ/piano room
25528-080725-81		Second Level – room next to organ/piano room
25528-080725-82	Gray floor leveler with black spots	Second Level – room next to organ/piano room
25528-080725-83		Second Level – room next to organ/piano room
25528-080725-84		Second Level – room next to organ/piano room
25528-080725-85	Fiberglass insulation Ductwork wrap with sealant	Second Level – room next to organ/piano room
25528-080725-86		Second Level – room next to organ/piano room
25528-080725-87		Second Level – room next to organ/piano room
25528-080725-88	Gray and white plaster walls	Second Level - organ/piano room
25528-080725-89		Second Level – room next to organ/piano room
25528-080725-90		First Level – west side chapel
25528-080725-91		First Level – east side chapel office
25528-080725-92		Lower Level – outside parish hall at east wall
25528-080725-93		Lower Level – outside parish hall at west wall
25528-080725-94		Lower level – parish hall area outside women's restroom
25528-080725-95	Smooth plaster wall covering	First Level – west side chapel
25528-080725-96		First Level – west side chapel
25528-080725-97		First Level – east side chapel
25528-080725-98	Textured plaster wall covering	First Level – east side chapel office
25528-080725-99		First Level – east side chapel office
25528-080725-100		First Level – east side chapel office

192506218

Sample #	Material	Location
25528-080725-101	Brown and white plaster walls	First Level – east side chapel next to statue
25528-080725-102		First Level – east side chapel next to statue
25528-080725-103		Lower Level – east wall
25528-080725-104		Lower Level – east wall
25528-080725-105		Lower Level – west wall
25528-080725-106		Lower Level – west wall
25528-080725-107		Lower Level – west wall
25528-080725-108	Plaster	Lower level – columns
25528-080725-109		Lower level – columns
25528-080725-110		Lower level – columns
25528-080725-111	Black ductwork panel covering	Lower level – next to women's restroom
25528-080725-112		Lower level – next to women's restroom
25528-080725-113		Lower level – next to women's restroom
25528-080725-114	Drywall	Lower level – storage room between kitchen and mech room
25528-080725-115		Lower level – men's restroom
25528-080725-116		First Level – chapel east office
25528-080725-117	Joint compound	Lower level – storage room between kitchen and mech room
25528-080725-118		Lower level – men's restroom
25528-080725-119		First Level – chapel east office
25528-080725-120	Textured ceiling (popcorn ceiling)	First Level – south entrance corridor
25528-080725-121		First Level – south entrance corridor
25528-080725-122		First Level – south entrance corridor
25528-080725-123	2' x 4' ceiling tile with pinoles and pockmarks	First Level – chapel east office
25528-080725-124		First Level – chapel east office
25528-080725-125		First Level – chapel east office
25528-080725-126	Plaster ceiling	First Level – chapel east office
25528-080725-127		First Level – chapel east office
25528-080725-128		First Level – chapel east office
25528-080725-129	2' x 2' textured ceiling tile with pinoles	Lower level – women's restroom
25528-080725-130		Lower level – women's restroom
25528-080725-131		Lower level – women's restroom
25528-080725-132	2' x 4' ceiling tile with large gouges and pockmarks	Lower level – outside parish hall
25528-080725-133		Lower Level – above women's restroom drop ceiling
25528-080725-134		Lower Level – parish hall
25528-080725-135	Brown pipe wrap with adhesive	Lower Level – above women's restroom drop ceiling
25528-080725-136		Lower Level – above women's restroom drop ceiling
25528-080725-137		Lower Level – above women's restroom drop ceiling
25528-080725-138	Stained window glazing (interior)	First Level – west wall (accessible working window)
25528-080725-139		First Level – west wall (accessible working window)
25528-080725-140		First Level – west wall (accessible working window)
25528-080725-141	Stained window glazing (exterior)	First Level – west wall (accessible working window)
25528-080725-142		First Level – west wall (accessible working window)
25528-080725-143		First Level – west wall (accessible working window)
25528-080725-144	Stained window frame caulking (exterior)	First Level – west wall (accessible working window)
25528-080725-145		First Level – west wall (accessible working window)
25528-080725-146		First Level – west wall (accessible working window)

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-01-Floor Tile *192506218-0001*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH GRAY ADHESIVE / LOWER LEVEL - PARISH HALL STAIR AREA	Gray/Black/Beige Non-Fibrous Heterogeneous		55% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
25528-080725-01-Adhesive *192506218-0001A*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH GRAY ADHESIVE / LOWER LEVEL - PARISH HALL STAIR AREA	Gray/White/Yellow Fibrous Heterogeneous	40% Glass	30% Ca Carbonate 30.0% Non-fibrous (Other)	**None Detected**
25528-080725-02-Floor Tile *192506218-0002*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH GRAY ADHESIVE / LOWER LEVEL - PARISH HALL STAIR AREA	Gray/Black/Beige Non-Fibrous Heterogeneous		60% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
25528-080725-02-Adhesive *192506218-0002A*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH GRAY ADHESIVE / LOWER LEVEL - PARISH HALL STAIR AREA	Gray/White/Yellow Fibrous Heterogeneous	40% Glass	30% Ca Carbonate 30.0% Non-fibrous (Other)	**None Detected**
25528-080725-03-Floor Tile *192506218-0003*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH GRAY ADHESIVE / LOWER LEVEL - PARISH HALL STAIR AREA	Gray/Black/Beige Non-Fibrous Heterogeneous		60% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-03-A dhesive *192506218-0003A*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH GRAY ADHESIVE / LOWER LEVEL - PARISH HALL STAIR AREA	Gray/White/Yellow Fibrous Heterogeneous	40% Glass	30% Ca Carbonate 30.0% Non-fibrous (Other)	**None Detected**
25528-080725-04-Fl oor Tile *192506218-0004*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH YELLOW ADHESIVE / LOWER LEVEL - PARISH HALL MAIN SEATING AREA OUTSIDE RESTROOM	Gray/Black Fibrous Heterogeneous	5% Synthetic	60% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-04-A dhesive *192506218-0004A*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH YELLOW ADHESIVE / LOWER LEVEL - PARISH HALL MAIN SEATING AREA OUTSIDE RESTROOM	Brown/Yellow Fibrous Heterogeneous	25% Cellulose	30% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
25528-080725-05-Fl oor Tile *192506218-0005*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH YELLOW ADHESIVE / LOWER LEVEL - PARISH HALL MAIN SEATING AREA SECOND COLUMN FROM RESTROOM	Gray/Black Fibrous Heterogeneous	5% Synthetic	60% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-05-A dhesive *192506218-0005A*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH YELLOW ADHESIVE / LOWER LEVEL - PARISH HALL MAIN SEATING AREA SECOND COLUMN FROM RESTROOM	Brown/Yellow Fibrous Heterogeneous	35% Cellulose	30% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-06-Fl oor Tile *192506218-0006*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH YELLOW ADHESIVE / LOWER LEVEL - PARISH HALL MAIN SEATING AREA COLUMN IN FRONT OF STAGE	Gray/Black Fibrous Heterogeneous	5% Synthetic	60% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-06-A dhesive *192506218-0006A*	18" X 18" DARK STONE PATTERNED FLOOR TILES WITH YELLOW ADHESIVE / LOWER LEVEL - PARISH HALL MAIN SEATING AREA COLUMN IN FRONT OF STAGE	Brown/Gray/Yellow Fibrous Heterogeneous	35% Cellulose	30% Matrix 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-07 *192506218-0007*	BROWN LAYER BETWEEN WOOD LAYERS / LOWER LEVEL - PARISH HALL OUTSIDE MEN'S RESTROOM	Brown/Gray/Yellow Fibrous Heterogeneous	25% Cellulose 7% Synthetic	20% Ca Carbonate 48.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-08 *192506218-0008*	BROWN LAYER BETWEEN WOOD LAYERS / LOWER LEVEL - CENTER OF PARISH HALL	Brown/Gray/Yellow Fibrous Heterogeneous	25% Cellulose 10% Synthetic	25% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
25528-080725-09 *192506218-0009*	BROWN LAYER BETWEEN WOOD LAYERS / LOWER LEVEL - PARISH HALL OUTSIDE OF KITCHEN	Brown/Gray/Yellow Fibrous Heterogeneous	25% Cellulose 5% Synthetic	25% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
25528-080725-10 *192506218-0010*	CERAMIC TILE GROUT / LOWER LEVEL - PARISH HALL SIDE KITCHEN/ BAR	Brown/Beige Non-Fibrous Heterogeneous	5% Cellulose 10% Synthetic	45% Quartz 25% Ca Carbonate 15.0% Non-fibrous (Other)	**None Detected**
25528-080725-11 *192506218-0011*	CERAMIC TILE GROUT / LOWER LEVEL - PARISH HALL MEN'S RESTROOM	Gray/White/Beige Fibrous Heterogeneous	5% Synthetic	50% Quartz 35% Ca Carbonate 10.0% Non-fibrous (Other)	**None Detected**
25528-080725-12 *192506218-0012*	CERAMIC TILE GROUT / LOWER LEVEL - PARISH HALL WOMEN'S RESTROOM	Gray/White/Beige Fibrous Heterogeneous	7% Synthetic	45% Quartz 35% Ca Carbonate 13.0% Non-fibrous (Other)	**None Detected**
25528-080725-13-Floor Tile *192506218-0013*	12" X 12" TAN WITH DARK STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Tan/White Non-Fibrous Heterogeneous	Suggest TEM NOB!!!!	60% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
25528-080725-13-Adhesive *192506218-0013A*	12" X 12" TAN WITH DARK STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Gray/Yellow Fibrous Heterogeneous	35% Cellulose	20% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-14-Floor Tile *192506218-0014*	12" X 12" TAN WITH DARK STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Tan/White Non-Fibrous Heterogeneous		55% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
			Suggest TEM NOB!!!!		
25528-080725-14-Adhesive *192506218-0014A*	12" X 12" TAN WITH DARK STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Yellow Fibrous Heterogeneous	40% Cellulose	25% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-15-Floor Tile *192506218-0015*	12" X 12" TAN WITH DARK STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Tan/White Non-Fibrous Heterogeneous		60% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
			Suggest TEM NOB!!!!		
25528-080725-15-Adhesive *192506218-0015A*	12" X 12" TAN WITH DARK STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Yellow Fibrous Heterogeneous	40% Cellulose	25% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-16-Floor Tile *192506218-0016*	12" X 12" BROWN WITH WHITE STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Tan/White Fibrous Heterogeneous	5% Cellulose	55% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
			Suggest TEM NOB!!!		

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-16-A dhesive *192506218-0016A*	12" X 12" BROWN WITH WHITE STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Gray/Yellow Fibrous Heterogeneous	40% Cellulose	25% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-17-Fl oor Tile *192506218-0017*	12" X 12" BROWN WITH WHITE STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Tan/White Fibrous Heterogeneous		55% Ca Carbonate 43.0% Non-fibrous (Other)	**2% Chrysotile**
25528-080725-17-A dhesive *192506218-0017A*	12" X 12" BROWN WITH WHITE STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Yellow Fibrous Heterogeneous	35% Cellulose	30% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-18-Fl oor Tile *192506218-0018*	12" X 12" BROWN WITH WHITE STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE				**Positive Stop (Not Analyzed)**
25528-080725-18-A dhesive *192506218-0018A*	12" X 12" BROWN WITH WHITE STREAKS FLOOR TILE AND ADHESIVE / LOWER LEVEL - PARISH HALL STAGE	Brown/Yellow Fibrous Heterogeneous	40% Cellulose	30% Ca Carbonate 30.0% Non-fibrous (Other)	**None Detected**
25528-080725-19-Li noleum Flooring *192506218-0019*	GREEN LINOLEUM FLOORING WITH ADHESIVE / LOWER LEVEL - PARISH HALL KITCHEN	Gray/Silver/Green Non-Fibrous Heterogeneous		35% Ca Carbonate 65.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-19-A dhesive *192506218-0019A*	GREEN LINOLEUM FLOORING WITH ADHESIVE / LOWER LEVEL - PARISH HALL KITCHEN	Brown/Gray/Yellow Fibrous Heterogeneous	20% Cellulose 5% Synthetic	25% Ca Carbonate 50.0% Non-fibrous (Other)	**None Detected**
25528-080725-20-Li noleum Flooring *192506218-0020*	GREEN LINOLEUM FLOORING WITH ADHESIVE / LOWER LEVEL - PARISH HALL KITCHEN	Gray/Silver/Green Non-Fibrous Heterogeneous		40% Ca Carbonate 60.0% Non-fibrous (Other)	**None Detected**
25528-080725-20-A dhesive *192506218-0020A*	GREEN LINOLEUM FLOORING WITH ADHESIVE / LOWER LEVEL - PARISH HALL KITCHEN	Brown/Gray/Yellow Fibrous Heterogeneous	2% Cellulose 5% Synthetic	25% Ca Carbonate 68.0% Non-fibrous (Other)	**None Detected**
25528-080725-21-Li noleum Flooring *192506218-0021*	GREEN LINOLEUM FLOORING WITH ADHESIVE / LOWER LEVEL - PARISH HALL KITCHEN	Gray/Green Non-Fibrous Heterogeneous		35% Ca Carbonate 65.0% Non-fibrous (Other)	**None Detected**
25528-080725-21-A dhesive *192506218-0021A*	GREEN LINOLEUM FLOORING WITH ADHESIVE / LOWER LEVEL - PARISH HALL KITCHEN	Brown/Gray/Yellow Fibrous Heterogeneous	20% Cellulose	25% Ca Carbonate 55.0% Non-fibrous (Other)	**None Detected**
25528-080725-22-Li noleum *192506218-0022*	YELLOW LINOLEUM WITH ADHESIVE UNDER GREEN LINOLEUM / LOWER LEVEL - PARISH HALL KITCHEN	Tan/White/Yellow Non-Fibrous Heterogeneous		45% Ca Carbonate 55.0% Non-fibrous (Other)	**None Detected**
25528-080725-22-A dhesive *192506218-0022A*	YELLOW LINOLEUM WITH ADHESIVE UNDER GREEN LINOLEUM / LOWER LEVEL - PARISH HALL KITCHEN	Gray/Tan/Yellow Fibrous Heterogeneous	20% Cellulose 5% Synthetic	25% Ca Carbonate 50.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-23-Linoleum *192506218-0023*	YELLOW LINOLEUM WITH ADHESIVE UNDER GREEN LINOLEUM / LOWER LEVEL - PARISH HALL KITCHEN	Tan/White/Yellow Non-Fibrous Heterogeneous		45% Ca Carbonate 55.0% Non-fibrous (Other)	**None Detected**
25528-080725-23-Adhesive *192506218-0023A*	YELLOW LINOLEUM WITH ADHESIVE UNDER GREEN LINOLEUM / LOWER LEVEL - PARISH HALL KITCHEN	Gray/Tan/Yellow Fibrous Heterogeneous	10% Cellulose 5% Synthetic	20% Ca Carbonate 65.0% Non-fibrous (Other)	**None Detected**
25528-080725-24-Linoleum *192506218-0024*	YELLOW LINOLEUM WITH ADHESIVE UNDER GREEN LINOLEUM / LOWER LEVEL - PARISH HALL KITCHEN	Tan/White/Yellow Non-Fibrous Heterogeneous		45% Ca Carbonate 55.0% Non-fibrous (Other)	**None Detected**
25528-080725-24-Adhesive *192506218-0024A*	YELLOW LINOLEUM WITH ADHESIVE UNDER GREEN LINOLEUM / LOWER LEVEL - PARISH HALL KITCHEN	Gray/Tan/Yellow Fibrous Heterogeneous	15% Cellulose 5% Synthetic	20% Ca Carbonate 60.0% Non-fibrous (Other)	**None Detected**
25528-080725-25-Linoleum *192506218-0025*	YELLOW LINOLEUM WITH SQUARES FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/Gray/Yellow Fibrous Heterogeneous	20% Cellulose	20% Ca Carbonate 25.0% Non-fibrous (Other)	**35% Chrysotile**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-25-A dhesive *192506218-0025A*	YELLOW LINOLEUM WITH SQUARES FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/Gray/Yellow Fibrous Heterogeneous	20% Cellulose	25% Ca Carbonate 55.0% Non-fibrous (Other)	**None Detected**
25528-080725-26-Li noleum *192506218-0026*	YELLOW LINOLEUM WITH SQUARES FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM				**Positive Stop (Not Analyzed)**
25528-080725-26-A dhesive *192506218-0026A*	YELLOW LINOLEUM WITH SQUARES FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/Gray/Yellow Fibrous Heterogeneous	20% Cellulose	25% Ca Carbonate 55.0% Non-fibrous (Other)	**None Detected**
25528-080725-27-Li noleum *192506218-0027*	YELLOW LINOLEUM WITH SQUARES FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM				**Positive Stop (Not Analyzed)**
25528-080725-27-A dhesive *192506218-0027A*	YELLOW LINOLEUM WITH SQUARES FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Tan/Red/Rust Fibrous Heterogeneous	15% Cellulose	25% Ca Carbonate 10% Mica 50.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-28-Floor Tile *192506218-0028*	BROWN FLOOR TILES WITH MASTIC UNDER YELLOW WITH SQUARES LINOLEUM FLOORING / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/White/Red Fibrous Heterogeneous		45% Ca Carbonate 49.0% Non-fibrous (Other)	**6% Chrysotile**
25528-080725-28-Mastic *192506218-0028A*	BROWN FLOOR TILES WITH MASTIC UNDER YELLOW WITH SQUARES LINOLEUM FLOORING / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/Gray/Black Fibrous Heterogeneous	15% Cellulose 5% Synthetic	20% Quartz 55.0% Non-fibrous (Other)	**5% Chrysotile**
25528-080725-29-Floor Tile *192506218-0029*	BROWN FLOOR TILES WITH MASTIC UNDER YELLOW WITH SQUARES LINOLEUM FLOORING / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM				**Positive Stop (Not Analyzed)**
25528-080725-29-Mastic *192506218-0029A*	BROWN FLOOR TILES WITH MASTIC UNDER YELLOW WITH SQUARES LINOLEUM FLOORING / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM				**Positive Stop (Not Analyzed)**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-30-Floor Tile *192506218-0030*	BROWN FLOOR TILES WITH MASTIC UNDER YELLOW WITH SQUARES LINOLEUM FLOORING / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM				**Positive Stop (Not Analyzed)**
25528-080725-30-Mastic *192506218-0030A*	BROWN FLOOR TILES WITH MASTIC UNDER YELLOW WITH SQUARES LINOLEUM FLOORING / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM				**Positive Stop (Not Analyzed)**
25528-080725-31-Stair Flooring *192506218-0031*	BROWN STAIRS FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/Gray/Green Fibrous Heterogeneous	35% Cellulose	25% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
25528-080725-31-Adhesive *192506218-0031A*	BROWN STAIRS FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown Fibrous Heterogeneous	50% Cellulose	20% Ca Carbonate 30.0% Non-fibrous (Other)	**None Detected**
25528-080725-32-Stair Flooring *192506218-0032*	BROWN STAIRS FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/Gray/Green Fibrous Heterogeneous	35% Cellulose	30% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-32-A dhesive *192506218-0032A*	BROWN STAIRS FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/Gray Fibrous Heterogeneous	30% Cellulose	30% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
25528-080725-33-S tair Flooring *192506218-0033*	BROWN STAIRS FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/Gray/Green Fibrous Heterogeneous	35% Cellulose	30% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-33-A dhesive *192506218-0033A*	BROWN STAIRS FLOORING AND ADHESIVE / LOWER LEVEL - PARISH HALL STORAGE ROOM OF KITCHEN/ MECH ROOM	Brown/Gray Fibrous Heterogeneous	35% Cellulose	30% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-34 *192506218-0034*	GRAY RUBBER STAIR TREAD MASTIC / LOWER LEVEL - PARISH HALL CENTER STAIR LANDING	Gray/Tan/Yellow Fibrous Heterogeneous	3% Synthetic	25% Ca Carbonate 72.0% Non-fibrous (Other)	**None Detected**
25528-080725-35 *192506218-0035*	GRAY RUBBER STAIR TREAD MASTIC / LOWER LEVEL - PARISH HALL CENTER STAIR LANDING	Gray/Tan/Yellow Fibrous Heterogeneous	2% Synthetic	35% Ca Carbonate 63.0% Non-fibrous (Other)	**None Detected**
25528-080725-36 *192506218-0036*	GRAY RUBBER STAIR TREAD MASTIC / LOWER LEVEL - PARISH HALL CENTER STAIR	Gray/Tan/Yellow Fibrous Heterogeneous	15% Cellulose 3% Synthetic	30% Ca Carbonate 52.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-37-Floor Tile *192506218-0037*	18" X 18" THIN FLOOR TILES WITH ADHESIVE / LOWER LEVEL - PARISH HALL CENTER OF SPACE	Gray/White/Beige Fibrous Heterogeneous	25% Glass	25% Ca Carbonate 50.0% Non-fibrous (Other)	**None Detected**
25528-080725-37-Adhesive *192506218-0037A*	18" X 18" THIN FLOOR TILES WITH ADHESIVE / LOWER LEVEL - PARISH HALL CENTER OF SPACE	Brown/Gray/Clear Fibrous Heterogeneous	35% Cellulose	65.0% Non-fibrous (Other)	**None Detected**
25528-080725-38-Floor Tile *192506218-0038*	18" X 18" THIN FLOOR TILES WITH ADHESIVE / LOWER LEVEL - PARISH HALL CENTER OF SPACE	Gray/White/Beige Fibrous Heterogeneous	25% Glass	25% Ca Carbonate 50.0% Non-fibrous (Other)	**None Detected**
25528-080725-38-Adhesive *192506218-0038A*	18" X 18" THIN FLOOR TILES WITH ADHESIVE / LOWER LEVEL - PARISH HALL CENTER OF SPACE	Brown/Gray/Clear Fibrous Heterogeneous	35% Cellulose	65.0% Non-fibrous (Other)	**None Detected**
25528-080725-39-Floor Tile *192506218-0039*	18" X 18" THIN FLOOR TILES WITH ADHESIVE / LOWER LEVEL - PARISH HALL CENTER OF SPACE	Gray/White/Beige Fibrous Heterogeneous	30% Glass	25% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
25528-080725-39-Adhesive *192506218-0039A*	18" X 18" THIN FLOOR TILES WITH ADHESIVE / LOWER LEVEL - PARISH HALL CENTER OF SPACE	Brown/Gray/Clear Fibrous Heterogeneous	40% Cellulose	60.0% Non-fibrous (Other)	**None Detected**
25528-080725-40-Cove Base *192506218-0040*	COVE BASE AND TAN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF SIDE KITCHEN/ BAR	Gray/White Non-Fibrous Heterogeneous		40% Ca Carbonate 60.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-40-A dhesive *192506218-0040A*	COVE BASE AND TAN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF SIDE KITCHEN/ BAR	Tan/Yellow/Beige Fibrous Heterogeneous	15% Cellulose 10% Synthetic	30% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
25528-080725-41-C ove Base *192506218-0041*	COVE BASE AND TAN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF MEN'S RESTROOM	Gray Non-Fibrous Heterogeneous		45% Ca Carbonate 55.0% Non-fibrous (Other)	**None Detected**
25528-080725-41-A dhesive *192506218-0041A*	COVE BASE AND TAN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF MEN'S RESTROOM	Brown/Tan/Yellow Fibrous Heterogeneous	35% Cellulose 7% Synthetic	25% Ca Carbonate 33.0% Non-fibrous (Other)	**None Detected**
25528-080725-42-C ove Base *192506218-0042*	COVE BASE AND TAN ADHESIVE / LOWER LEVEL - PARISH HALL CENTER OF SPACE ON COLUMN	Gray Non-Fibrous Heterogeneous		40% Ca Carbonate 60.0% Non-fibrous (Other)	**None Detected**
25528-080725-42-A dhesive *192506218-0042A*	COVE BASE AND TAN ADHESIVE / LOWER LEVEL - PARISH HALL CENTER OF SPACE ON COLUMN	Tan/Yellow/Beige Fibrous Heterogeneous	15% Cellulose 7% Synthetic	30% Ca Carbonate 48.0% Non-fibrous (Other)	**None Detected**
25528-080725-43-C ove Base *192506218-0043*	COVE BASE AND BROWN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF SIDE KITCHEN/ BAR	Gray/White Fibrous Heterogeneous	5% Synthetic	45% Ca Carbonate 50.0% Non-fibrous (Other)	**None Detected**
25528-080725-43-A dhesive *192506218-0043A*	COVE BASE AND BROWN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF SIDE KITCHEN/ BAR	Brown/Gray Fibrous Heterogeneous	7% Cellulose 5% Fibrous_Other	25% Ca Carbonate 63.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-44-Cove Base *192506218-0044*	COVE BASE AND BROWN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF SIDE KITCHEN/ BAR	Brown/Gray Fibrous Heterogeneous	10% Synthetic	45% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
25528-080725-44-Adhesive *192506218-0044A*	COVE BASE AND BROWN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF SIDE KITCHEN/ BAR	Brown/Gray/White Fibrous Heterogeneous	7% Cellulose 10% Synthetic 5% Fibrous_Other	25% Ca Carbonate 53.0% Non-fibrous (Other)	**None Detected**
25528-080725-45-Cove Base *192506218-0045*	COVE BASE AND BROWN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF SIDE KITCHEN/ BAR	Brown/Gray Fibrous Heterogeneous	7% Synthetic	45% Ca Carbonate 48.0% Non-fibrous (Other)	**None Detected**
25528-080725-45-Adhesive *192506218-0045A*	COVE BASE AND BROWN ADHESIVE / LOWER LEVEL - PARISH HALL OUTSIDE OF SIDE KITCHEN/ BAR	Brown/Gray/White Fibrous Heterogeneous	10% Cellulose 5% Synthetic 5% Fibrous_Other	25% Ca Carbonate 55.0% Non-fibrous (Other)	**None Detected**
25528-080725-46 *192506218-0046*	TERRAZZO FLOORING / FIRST LEVEL - SOUTH ENTRANCE CORRIDOR	Gray/White/Beige Fibrous Heterogeneous	5% Synthetic	55% Quartz 30% Ca Carbonate 10.0% Non-fibrous (Other)	**None Detected**
25528-080725-47 *192506218-0047*	TERRAZZO FLOORING / FIRST LEVEL - SOUTH ENTRANCE CORRIDOR	Gray/White/Beige Fibrous Heterogeneous	10% Synthetic	55% Quartz 25% Ca Carbonate 10.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-48 *192506218-0048*	TERRAZZO FLOORING / FIRST LEVEL - SOUTH ENTRANCE CORRIDOR	Gray/Green/Beige Fibrous Heterogeneous	5% Synthetic	55% Quartz 30% Ca Carbonate 10.0% Non-fibrous (Other)	**<1% Chrysotile**
			Lizardite crystals(non-fibrous form of the serpentine chrysotile) were found in this sample. They could become, protentially, hazardous if they are crushed and pulverized: thus, fiberous in nature.		
25528-080725-49 *192506218-0049*	YELLOW CARPET GLUE / FIRST LEVEL - SOUTH ENTRANCE CORRIDOR	Brown/Gray/Yellow Fibrous Heterogeneous	30% Cellulose 20% Synthetic	15% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-50 *192506218-0050*	YELLOW CARPET GLUE / FIRST LEVEL - SOUTH ENTRANCE CORRIDOR	Brown/Gray/Yellow Fibrous Heterogeneous	35% Cellulose 15% Synthetic	15% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-51 *192506218-0051*	YELLOW CARPET GLUE / FIRST LEVEL - SOUTH ENTRANCE CORRIDOR	Brown/Gray/Yellow Fibrous Heterogeneous	12% Cellulose 30% Synthetic	25% Ca Carbonate 33.0% Non-fibrous (Other)	**None Detected**
25528-080725-52-Floor Tile *192506218-0052*	12" X 12" BLUE MOTTLED FLOOR TILES WITH ADHESIVE/ FIRST LEVEL - CHAPEL	Gray/White/Blue Non-Fibrous Heterogeneous		60% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
25528-080725-52-Adhesive *192506218-0052A*	12" X 12" BLUE MOTTLED FLOOR TILES WITH ADHESIVE/ FIRST LEVEL - CHAPEL	Tan/Yellow Fibrous Heterogeneous	10% Cellulose 5% Synthetic	25% Ca Carbonate 60.0% Non-fibrous (Other)	**None Detected**
25528-080725-53-Floor Tile *192506218-0053*	12" X 12" BLUE MOTTLED FLOOR TILES WITH ADHESIVE/ FIRST LEVEL - CHAPEL	Gray/White/Blue Non-Fibrous Heterogeneous		60% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-53-Adhesive *192506218-0053A*	12" X 12" BLUE MOTTLED FLOOR TILES WITH ADHESIVE/ FIRST LEVEL - CHAPEL	Tan/Yellow Fibrous Heterogeneous	5% Synthetic	25% Ca Carbonate 70.0% Non-fibrous (Other)	**None Detected**
25528-080725-54-Floor Tile *192506218-0054*	12" X 12" BLUE MOTTLED FLOOR TILES WITH ADHESIVE/ FIRST LEVEL - ORGAN/ PIANO ROOM	Gray/White/Blue Non-Fibrous Heterogeneous		60% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
25528-080725-54-Adhesive *192506218-0054A*	12" X 12" BLUE MOTTLED FLOOR TILES WITH ADHESIVE/ FIRST LEVEL - ORGAN/ PIANO ROOM	Brown/Tan/Yellow Fibrous Heterogeneous	25% Cellulose 5% Synthetic	25% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
25528-080725-55 *192506218-0055*	BROWN CARPET GLUE / FIRST LEVEL - ALTER CARPET	Brown/Red/Yellow Fibrous Heterogeneous	40% Cellulose 20% Synthetic	15% Ca Carbonate 25.0% Non-fibrous (Other)	**None Detected**
25528-080725-56 *192506218-0056*	BROWN CARPET GLUE / FIRST LEVEL - ALTER CARPET	Brown/Red/Yellow Fibrous Heterogeneous	40% Cellulose 20% Synthetic	15% Ca Carbonate 25.0% Non-fibrous (Other)	**None Detected**
25528-080725-57 *192506218-0057*	BROWN CARPET GLUE / FIRST LEVEL - ALTER CARPET	Brown/Gray/Red Fibrous Heterogeneous	35% Cellulose 25% Synthetic	15% Ca Carbonate 25.0% Non-fibrous (Other)	**None Detected**
25528-080725-58-Floor Tile *192506218-0058*	9" X 9" RED FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	White/Red/Black Fibrous Heterogeneous	20% Cellulose	45% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-58-Mastic/Felt *192506218-0058A*	9" X 9" RED FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	Brown/Gray/Black Fibrous Heterogeneous	40% Cellulose 20% Synthetic	10% Ca Carbonate 30.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-59-Floor Tile *192506218-0059*	9" X 9" RED FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	White/Red/Black Fibrous Heterogeneous	25% Cellulose	30% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
25528-080725-59-Mastic/Felt *192506218-0059A*	9" X 9" RED FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	Brown/Gray/Black Fibrous Heterogeneous	40% Cellulose 20% Synthetic	15% Ca Carbonate 25.0% Non-fibrous (Other)	**None Detected**
25528-080725-60-Floor Tile *192506218-0060*	9" X 9" RED FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	White/Red/Black Fibrous Heterogeneous	25% Cellulose	40% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-60-Mastic/Felt *192506218-0060A*	9" X 9" RED FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	Brown/Gray/Black Fibrous Heterogeneous	40% Cellulose 20% Synthetic	15% Ca Carbonate 25.0% Non-fibrous (Other)	**None Detected**
25528-080725-61-Floor Tile *192506218-0061*	9" X 9" TAN/ GRAY FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	Gray/Tan/Various Fibrous Heterogeneous	25% Synthetic	40% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-61-Mastic/Felt *192506218-0061A*	9" X 9" TAN/ GRAY FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	Brown/Gray/Black Fibrous Heterogeneous	40% Cellulose 20% Synthetic	15% Ca Carbonate 25.0% Non-fibrous (Other)	**None Detected**
25528-080725-62-Floor Tile *192506218-0062*	9" X 9" TAN/ GRAY FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	Gray/Tan/Various Fibrous Heterogeneous	20% Cellulose	40% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-62-Mastic/felt *192506218-0062A*	9" X 9" TAN/ GRAY FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	Brown/Gray/Black Fibrous Heterogeneous	40% Cellulose 20% Synthetic	15% Ca Carbonate 25.0% Non-fibrous (Other)	**None Detected**
25528-080725-63-Floor Tile *192506218-0063*	9" X 9" TAN/ GRAY FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	Gray/Tan/Various Fibrous Heterogeneous	20% Cellulose	40% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
25528-080725-63-Mastic/Felt *192506218-0063A*	9" X 9" TAN/ GRAY FLOOR TILES WITH BLACK MASTIC/ FIRST LEVEL - CHAPEL EAST OFFICE	Brown/Gray/Black Fibrous Heterogeneous	40% Cellulose 20% Synthetic	15% Ca Carbonate 25.0% Non-fibrous (Other)	**None Detected**
25528-080725-64 *192506218-0064*	TILE GROUT/ FIRST LEVEL - CHAPEL ALTER EAST	Brown/Gray/Beige Fibrous Heterogeneous	20% Cellulose 3% Synthetic	35% Quartz 30% Ca Carbonate 12.0% Non-fibrous (Other)	**None Detected**
25528-080725-65 *192506218-0065*	TILE GROUT/ FIRST LEVEL - CHAPEL ALTER NORTH	Brown/Gray/Beige Fibrous Heterogeneous	5% Synthetic	45% Quartz 35% Ca Carbonate 15.0% Non-fibrous (Other)	**None Detected**
25528-080725-66 *192506218-0066*	TILE GROUT/ FIRST LEVEL - CHAPEL ALTER WEST	Brown/Gray/Beige Fibrous Heterogeneous	10% Synthetic	45% Quartz 35% Ca Carbonate 10.0% Non-fibrous (Other)	**None Detected**
25528-080725-67-Stairs Flooring *192506218-0067*	BLACK STAIRS FLOORING WITH ADHESIVE / FIRST LEVEL - SOUTH ENTRANCE STAIRS TO SECOND FLOOR	Gray/White/Black Fibrous Heterogeneous	20% Cellulose	40% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-67-A dhesive *192506218-0067A*	BLACK STAIRS FLOORING WITH ADHESIVE / FIRST LEVEL - SOUTH ENTRANCE STAIRS TO SECOND FLOOR	Brown/Gray Fibrous Heterogeneous	35% Cellulose 7% Synthetic	25% Ca Carbonate 33.0% Non-fibrous (Other)	**None Detected**
25528-080725-68-S tairs Flooring *192506218-0068*	BLACK STAIRS FLOORING WITH ADHESIVE / FIRST LEVEL - SOUTH ENTRANCE STAIRS TO SECOND FLOOR	Gray/White/Black Fibrous Heterogeneous	20% Cellulose	40% Ca Carbonate 40.0% Non-fibrous (Other)	**None Detected**
25528-080725-68-A dhesive *192506218-0068A*	BLACK STAIRS FLOORING WITH ADHESIVE / FIRST LEVEL - SOUTH ENTRANCE STAIRS TO SECOND FLOOR	Brown/Gray Fibrous Heterogeneous	35% Cellulose	30% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-69-S tairs Flooring *192506218-0069*	BLACK STAIRS FLOORING WITH ADHESIVE / FIRST LEVEL - SOUTH ENTRANCE STAIRS TO SECOND FLOOR	Gray/White/Black Fibrous Heterogeneous	25% Cellulose	40% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-69-A dhesive *192506218-0069A*	BLACK STAIRS FLOORING WITH ADHESIVE / FIRST LEVEL - SOUTH ENTRANCE STAIRS TO SECOND FLOOR	Brown/Gray Fibrous Heterogeneous	35% Cellulose 5% Synthetic	30% Ca Carbonate 30.0% Non-fibrous (Other)	**None Detected**
25528-080725-70-Fl oor Tile *192506218-0070*	REPAIR TILES:12" X 12" TAN MOTTLED FLOOR TILES WITH ADHESIVE / SECOND LEVEL - ORGAN/ PIANO ROOM	Tan/Yellow/Orange Fibrous Heterogeneous		55% Ca Carbonate 41.0% Non-fibrous (Other)	**4% Chrysotile**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-70-A dhesive *192506218-0070A*	REPAIR TILES:12" X 12" TAN MOTTLED FLOOR TILES WITH ADHESIVE / SECOND LEVEL - ORGAN/ PIANO ROOM	Tan/Yellow Fibrous Heterogeneous	3% Synthetic	25% Ca Carbonate 72.0% Non-fibrous (Other)	**None Detected**
25528-080725-71-Fl oor Tile *192506218-0071*	REPAIR TILES:12" X 12" TAN MOTTLED FLOOR TILES WITH ADHESIVE / SECOND LEVEL - ORGAN/ PIANO ROOM				**Positive Stop (Not Analyzed)**
25528-080725-71-A dhesive *192506218-0071A*	REPAIR TILES:12" X 12" TAN MOTTLED FLOOR TILES WITH ADHESIVE / SECOND LEVEL - ORGAN/ PIANO ROOM	Brown/Tan/Yellow Fibrous Heterogeneous	15% Cellulose 3% Synthetic	25% Ca Carbonate 57.0% Non-fibrous (Other)	**None Detected**
25528-080725-72-Fl oor Tile *192506218-0072*	REPAIR TILES:12" X 12" TAN MOTTLED FLOOR TILES WITH ADHESIVE / SECOND LEVEL - ORGAN/ PIANO ROOM				**Positive Stop (Not Analyzed)**
25528-080725-72-A dhesive *192506218-0072A*	REPAIR TILES:12" X 12" TAN MOTTLED FLOOR TILES WITH ADHESIVE / SECOND LEVEL - ORGAN/ PIANO ROOM	Brown/Tan/Yellow Fibrous Heterogeneous	25% Cellulose	30% Ca Carbonate 45.0% Non-fibrous (Other)	**None Detected**
25528-080725-73-Fl oor Tile *192506218-0073*	9" X 9" DARK GRAY FLOOR TILES WITH BLACK MASTIC / SECOND LEVEL - ORGAN/ PIANO ROOM	Gray Non-Fibrous Homogeneous		35% Ca Carbonate 52.0% Non-fibrous (Other)	**13% Chrysotile**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-73-Mastic *192506218-0073A*	9" X 9" DARK GRAY FLOOR TILES WITH BLACK MASTIC / SECOND LEVEL - ORGAN/ PIANO ROOM	Black Non-Fibrous Homogeneous		96.0% Non-fibrous (Other)	**4% Chrysotile**
25528-080725-74-Floor Tile *192506218-0074*	9" X 9" DARK GRAY FLOOR TILES WITH BLACK MASTIC / SECOND LEVEL - ORGAN/ PIANO ROOM				**Positive Stop (Not Analyzed)**
25528-080725-74-Mastic *192506218-0074A*	9" X 9" DARK GRAY FLOOR TILES WITH BLACK MASTIC / SECOND LEVEL - ORGAN/ PIANO ROOM				**Positive Stop (Not Analyzed)**
25528-080725-75-Floor Tile *192506218-0075*	9" X 9" DARK GRAY FLOOR TILES WITH BLACK MASTIC / SECOND LEVEL - ORGAN/ PIANO ROOM				**Positive Stop (Not Analyzed)**
25528-080725-75-Mastic *192506218-0075A*	9" X 9" DARK GRAY FLOOR TILES WITH BLACK MASTIC / SECOND LEVEL - ORGAN/ PIANO ROOM				**Positive Stop (Not Analyzed)**
25528-080725-76 *192506218-0076*	YELLOW CARPET GLUE (POWDER) / SECOND LEVEL - ORGAN/ PIANO ROOM	Yellow Non-Fibrous Homogeneous	3% Synthetic	10% Ca Carbonate 87.0% Non-fibrous (Other)	**None Detected**
25528-080725-77 *192506218-0077*	YELLOW CARPET GLUE (POWDER) / SECOND LEVEL - ORGAN/ PIANO ROOM	Yellow Non-Fibrous Homogeneous	2% Synthetic	12% Ca Carbonate 86.0% Non-fibrous (Other)	**None Detected**
25528-080725-78 *192506218-0078*	YELLOW CARPET GLUE (POWDER) / SECOND LEVEL - ORGAN/ PIANO ROOM	Yellow Non-Fibrous Homogeneous	2% Synthetic	10% Ca Carbonate 88.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-79 *192506218-0079*	VAPOR BARRIER PAPER / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Brown Non-Fibrous Homogeneous	95% Cellulose	5.0% Non-fibrous (Other)	**None Detected**
25528-080725-80 *192506218-0080*	VAPOR BARRIER PAPER / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Brown Non-Fibrous Homogeneous	97% Cellulose	3.0% Non-fibrous (Other)	**None Detected**
25528-080725-81 *192506218-0081*	VAPOR BARRIER PAPER / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Brown Non-Fibrous Homogeneous	96% Cellulose	4.0% Non-fibrous (Other)	**None Detected**
25528-080725-82 *192506218-0082*	GRAY FLOOR LEVELER WITH BLACK SPOTS / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Gray Non-Fibrous Homogeneous		23% Quartz 77.0% Non-fibrous (Other)	**None Detected**
25528-080725-83 *192506218-0083*	GRAY FLOOR LEVELER WITH BLACK SPOTS / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Gray Non-Fibrous Homogeneous		26% Quartz 74.0% Non-fibrous (Other)	**None Detected**
25528-080725-84 *192506218-0084*	GRAY FLOOR LEVELER WITH BLACK SPOTS / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Black Non-Fibrous Homogeneous		100.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-85 *192506218-0085*	FIBERGLASS INSULATION DUCTWORK WRAP WITH SEALANT / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Brown/White/Silver Non-Fibrous Homogeneous	60% Cellulose	40.0% Non-fibrous (Other)	**None Detected**
25528-080725-86 *192506218-0086*	FIBERGLASS INSULATION DUCTWORK WRAP WITH SEALANT / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Brown/White/Silver Non-Fibrous Homogeneous	55% Cellulose	45.0% Non-fibrous (Other)	**None Detected**
25528-080725-87 *192506218-0087*	FIBERGLASS INSULATION DUCTWORK WRAP WITH SEALANT / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Brown/White/Silver Non-Fibrous Homogeneous	60% Cellulose	40.0% Non-fibrous (Other)	**None Detected**
25528-080725-88-S kim Coat *192506218-0088*	GRAY AND WHITE PLASTER WALLS / SECOND LEVEL - ORGAN/ PIANO ROOM	White Non-Fibrous Homogeneous		25% Quartz 75.0% Non-fibrous (Other)	**None Detected**
25528-080725-88-R ough Coat *192506218-0088A*	GRAY AND WHITE PLASTER WALLS / SECOND LEVEL - ORGAN/ PIANO ROOM	Beige Non-Fibrous Homogeneous	7% Hair	35% Quartz 58.0% Non-fibrous (Other)	**None Detected**
25528-080725-89-S kim Coat *192506218-0089*	GRAY AND WHITE PLASTER WALLS / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	White Non-Fibrous Homogeneous		25% Quartz 75.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-89-Rough Coat *192506218-0089A*	GRAY AND WHITE PLASTER WALLS / SECOND LEVEL - ROOM NEXT TO ORGAN/ PIANO ROOM	Beige Non-Fibrous Homogeneous	6% Hair	35% Quartz 59.0% Non-fibrous (Other)	**None Detected**
25528-080725-90-Skim Coat *192506218-0090*	GRAY AND WHITE PLASTER WALLS / WEST SIDE CHAPEL	White Non-Fibrous Homogeneous		27% Quartz 73.0% Non-fibrous (Other)	**None Detected**
25528-080725-90-Rough Coat *192506218-0090A*	GRAY AND WHITE PLASTER WALLS / WEST SIDE CHAPEL	Beige Non-Fibrous Homogeneous	8% Hair	35% Quartz 57.0% Non-fibrous (Other)	**None Detected**
25528-080725-91 *192506218-0091*	GRAY AND WHITE PLASTER WALLS / EAST SIDE CHAPEL OFFICE	White Non-Fibrous Homogeneous		25% Quartz 75.0% Non-fibrous (Other)	**None Detected**
25528-080725-92-Skim Coat *192506218-0092*	GRAY AND WHITE PLASTER WALLS / LOWER LEVEL - OUTSIDE PARISH HALL AT EAST WALL	White Non-Fibrous Homogeneous		25% Quartz 75.0% Non-fibrous (Other)	**None Detected**
25528-080725-92-Rough Coat *192506218-0092A*	GRAY AND WHITE PLASTER WALLS / LOWER LEVEL - OUTSIDE PARISH HALL AT EAST WALL	Beige Non-Fibrous Homogeneous	7% Hair	35% Quartz 58.0% Non-fibrous (Other)	**None Detected**
25528-080725-93-Skim Coat *192506218-0093*	GRAY AND WHITE PLASTER WALLS / LOWER LEVEL - OUTSIDE PARISH HALL AT WEST WALL	White Non-Fibrous Homogeneous		25% Quartz 75.0% Non-fibrous (Other)	**None Detected**
25528-080725-93-Rough Coat *192506218-0093A*	GRAY AND WHITE PLASTER WALLS / LOWER LEVEL - OUTSIDE PARISH HALL AT WEST WALL	Beige Non-Fibrous Homogeneous	6% Hair	35% Quartz 59.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-94-S kim Coat *192506218-0094*	GRAY AND WHITE PLASTER WALLS / LOWER LEVEL - PARISH HALL AREA OUTSIDE WOMEN'S RESTROOM	White/Beige Non-Fibrous Homogeneous		85% Ca Carbonate 15.0% Non-fibrous (Other)	**None Detected**
25528-080725-94-R ough Coat *192506218-0094A*	GRAY AND WHITE PLASTER WALLS / LOWER LEVEL - PARISH HALL AREA OUTSIDE WOMEN'S RESTROOM	Gray Non-Fibrous Homogeneous		35% Mica 65.0% Non-fibrous (Other)	**None Detected**
25528-080725-95 *192506218-0095*	SMOOTH PLASTER WALL COVERING / FIRST LEVEL - WEST SIDE CHAPEL	Gray/White Non-Fibrous Homogeneous	30% Glass	70.0% Non-fibrous (Other)	**None Detected**
25528-080725-96 *192506218-0096*	SMOOTH PLASTER WALL COVERING / FIRST LEVEL - WEST SIDE CHAPEL	Gray/White Non-Fibrous Homogeneous	32% Glass	68.0% Non-fibrous (Other)	**None Detected**
25528-080725-97 *192506218-0097*	SMOOTH PLASTER WALL COVERING / FIRST LEVEL - WEST SIDE CHAPEL	Gray/White Non-Fibrous Homogeneous	34% Glass	66.0% Non-fibrous (Other)	**None Detected**
25528-080725-98 *192506218-0098*	TEXTURED PLASTER WALL COVERING / FIRST LEVEL - EAST SIDE CHAPEL OFFICE	White Non-Fibrous Homogeneous	45% Glass	55.0% Non-fibrous (Other)	**None Detected**
25528-080725-99 *192506218-0099*	TEXTURED PLASTER WALL COVERING / FIRST LEVEL - EAST SIDE CHAPEL OFFICE	White Non-Fibrous Homogeneous	40% Glass	60.0% Non-fibrous (Other)	**None Detected**
25528-080725-100 *192506218-0100*	TEXTURED PLASTER WALL COVERING / FIRST LEVEL - EAST SIDE CHAPEL OFFICE	White Non-Fibrous Homogeneous	45% Glass	55.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-101-Skim Coat *192506218-0101*	BROWN AND WHITE PLASTER WALLS / FIRST LEVEL - EAST SIDE CHAPEL NEXT TO STATUE	White Non-Fibrous Homogeneous	10% Glass	30% Quartz 60.0% Non-fibrous (Other)	**None Detected**
25528-080725-101-Rough Coat *192506218-0101A*	BROWN AND WHITE PLASTER WALLS / FIRST LEVEL - EAST SIDE CHAPEL NEXT TO STATUE	Tan Non-Fibrous Homogeneous	6% Hair	40% Quartz 54.0% Non-fibrous (Other)	**None Detected**
25528-080725-102-Skim Coat *192506218-0102*	BROWN AND WHITE PLASTER WALLS / FIRST LEVEL - EAST SIDE CHAPEL NEXT TO STATUE	White Non-Fibrous Homogeneous		30% Quartz 70.0% Non-fibrous (Other)	**None Detected**
25528-080725-102-Rough Coat *192506218-0102A*	BROWN AND WHITE PLASTER WALLS / FIRST LEVEL - EAST SIDE CHAPEL NEXT TO STATUE	Tan Non-Fibrous Homogeneous	7% Hair	30% Quartz 63.0% Non-fibrous (Other)	**None Detected**
25528-080725-103-Skim Coat *192506218-0103*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - EAST WALL	White Non-Fibrous Homogeneous		27% Quartz 73.0% Non-fibrous (Other)	**None Detected**
25528-080725-103-Rough Coat *192506218-0103A*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - EAST WALL	Tan Non-Fibrous Homogeneous	6% Hair	40% Quartz 54.0% Non-fibrous (Other)	**None Detected**
25528-080725-104-Skim Coat *192506218-0104*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - EAST WALL	White Non-Fibrous Homogeneous		27% Quartz 73.0% Non-fibrous (Other)	**None Detected**
25528-080725-104-Rough Coat *192506218-0104A*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - EAST WALL	Tan Non-Fibrous Homogeneous	8% Hair	26% Quartz 66.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-105-Skim Coat *192506218-0105*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - WEST WALL	White Non-Fibrous Homogeneous		28% Quartz 72.0% Non-fibrous (Other)	**None Detected**
25528-080725-105-Rough Coat *192506218-0105A*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - WEST WALL	Tan Non-Fibrous Homogeneous	6% Hair	38% Quartz 56.0% Non-fibrous (Other)	**None Detected**
25528-080725-106-Skim Coat *192506218-0106*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - WEST WALL	White Non-Fibrous Homogeneous		25% Quartz 75.0% Non-fibrous (Other)	**None Detected**
25528-080725-106-Rough Coat *192506218-0106A*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - WEST WALL	Tan Non-Fibrous Homogeneous	5% Hair	30% Quartz 65.0% Non-fibrous (Other)	**None Detected**
25528-080725-107-Skim Coat *192506218-0107*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - WEST WALL	White Non-Fibrous Homogeneous		30% Quartz 70.0% Non-fibrous (Other)	**None Detected**
25528-080725-107-Rough Coat *192506218-0107A*	BROWN AND WHITE PLASTER WALLS / LOWER LEVEL - WEST WALL	Tan Non-Fibrous Homogeneous	3% Hair	38% Quartz 59.0% Non-fibrous (Other)	**None Detected**
25528-080725-108 *192506218-0108*	PLASTER / LOWER LEVEL - COLUMNS	White Non-Fibrous Homogeneous		30% Quartz 70.0% Non-fibrous (Other)	**None Detected**
25528-080725-109 *192506218-0109*	PLASTER / LOWER LEVEL - COLUMNS	White Non-Fibrous Homogeneous		30% Quartz 70.0% Non-fibrous (Other)	**None Detected**
25528-080725-110 *192506218-0110*	PLASTER / LOWER LEVEL - COLUMNS	White Non-Fibrous Homogeneous		28% Quartz 72.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-111 *192506218-0111*	BLACK DUCTWORK PANEL COVERING / LOWER LEVEL - NEXT TO WOMEN'S RESTROOM	Black Non-Fibrous Homogeneous	65% Cellulose	35.0% Non-fibrous (Other)	**None Detected**
25528-080725-112 *192506218-0112*	BLACK DUCTWORK PANEL COVERING / LOWER LEVEL - NEXT TO WOMEN'S RESTROOM	Black Non-Fibrous Homogeneous	65% Cellulose	35.0% Non-fibrous (Other)	**None Detected**
25528-080725-113 *192506218-0113*	BLACK DUCTWORK PANEL COVERING / LOWER LEVEL - NEXT TO WOMEN'S RESTROOM	Black Non-Fibrous Homogeneous	65% Cellulose	35.0% Non-fibrous (Other)	**None Detected**
25528-080725-114 *192506218-0114*	DRYWALL / LOWER LEVEL - STORAGE ROOM BETWEEN KITCHEN AND MECH ROOM	Brown/White Non-Fibrous Homogeneous	25% Cellulose	70% Gypsum 5.0% Non-fibrous (Other)	**None Detected**
25528-080725-115 *192506218-0115*	DRYWALL / LOWER LEVEL - MEN'S RESTROOM	Brown/White Non-Fibrous Homogeneous	30% Cellulose	65% Gypsum 5.0% Non-fibrous (Other)	**None Detected**
25528-080725-116 *192506218-0116*	DRYWALL / FIRST LEVEL - CHAPEL EAST OFFICE	Brown/White Non-Fibrous Homogeneous	30% Cellulose	65% Gypsum 5.0% Non-fibrous (Other)	**None Detected**
25528-080725-117 *192506218-0117*	JOINT COMPOUND / LOWER LEVEL - STORAGE ROOM BETWEEN KITCHEN AND MECH ROOM	White Non-Fibrous Homogeneous		86% Ca Carbonate 14.0% Non-fibrous (Other)	**None Detected**
25528-080725-118 *192506218-0118*	JOINT COMPOUND / LOWER LEVEL - MEN'S RESTROOM	White Non-Fibrous Homogeneous		86% Ca Carbonate 14.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-119 *192506218-0119*	JOINT COMPOUND / FIRST LEVEL - CHAPEL EAST OFFICE	White Non-Fibrous Homogeneous		87% Ca Carbonate 13.0% Non-fibrous (Other)	**None Detected**
25528-080725-120 *192506218-0120*	TEXTURED CEILING (POPCORN CEILING) / FIRST LEVEL - SOUTH ENTRANCE CORRIDOR	White Non-Fibrous Homogeneous		87% Ca Carbonate 13.0% Non-fibrous (Other)	**None Detected**
25528-080725-121 *192506218-0121*	TEXTURED CEILING (POPCORN CEILING) / FIRST LEVEL - SOUTH ENTRANCE CORRIDOR	White Non-Fibrous Homogeneous		85% Ca Carbonate 15.0% Non-fibrous (Other)	**None Detected**
25528-080725-122 *192506218-0122*	TEXTURED CEILING (POPCORN CEILING) / FIRST LEVEL - SOUTH ENTRANCE CORRIDOR	White Non-Fibrous Homogeneous		87% Ca Carbonate 13.0% Non-fibrous (Other)	**None Detected**
25528-080725-123 *192506218-0123*	2' X 4' CEILING TILE WITH PINHOLES AND POCKMARKS / FIRST LEVEL - CHAPEL EAST OFFICE	Gray/White Non-Fibrous Homogeneous	35% Cellulose 30% Glass	30% Perlite 5.0% Non-fibrous (Other)	**None Detected**
25528-080725-124 *192506218-0124*	2' X 4' CEILING TILE WITH PINHOLES AND POCKMARKS / FIRST LEVEL - CHAPEL EAST OFFICE	Gray/White Non-Fibrous Homogeneous	35% Cellulose 30% Glass	30% Perlite 5.0% Non-fibrous (Other)	**None Detected**
25528-080725-125 *192506218-0125*	2' X 4' CEILING TILE WITH PINHOLES AND POCKMARKS / FIRST LEVEL - CHAPEL EAST OFFICE	Gray/White Non-Fibrous Homogeneous	35% Cellulose 30% Glass	30% Perlite 5.0% Non-fibrous (Other)	**None Detected**
25528-080725-126-Skim Coat *192506218-0126*	PLASTER CEILING / FIRST LEVEL - CHAPEL EAST OFFICE	Gray/Tan/White Non-Fibrous Heterogeneous		35% Quartz 30% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-126-Rough Coat *192506218-0126A*	PLASTER CEILING / FIRST LEVEL - CHAPEL EAST OFFICE	Brown/Gray/Rust Fibrous Heterogeneous	12% Hair	35% Quartz 30% Ca Carbonate 10% Mica 13.0% Non-fibrous (Other)	**None Detected**
25528-080725-127-Skim Coat *192506218-0127*	PLASTER CEILING / FIRST LEVEL - CHAPEL EAST OFFICE	Gray/Tan/White Non-Fibrous Heterogeneous		40% Quartz 30% Ca Carbonate 30.0% Non-fibrous (Other)	**None Detected**
25528-080725-127-Rough Coat *192506218-0127A*	PLASTER CEILING / FIRST LEVEL - CHAPEL EAST OFFICE	Brown/Gray/Rust Fibrous Heterogeneous	15% Hair	35% Quartz 30% Ca Carbonate 10% Mica 10.0% Non-fibrous (Other)	**None Detected**
25528-080725-128-Skim Coat *192506218-0128*	PLASTER CEILING / FIRST LEVEL - CHAPEL EAST OFFICE	Gray/Tan/White Non-Fibrous Heterogeneous		35% Quartz 30% Ca Carbonate 35.0% Non-fibrous (Other)	**None Detected**
25528-080725-128-Rough Coat *192506218-0128A*	PLASTER CEILING / FIRST LEVEL - CHAPEL EAST OFFICE	Brown/Gray/Rust Fibrous Heterogeneous	15% Hair	35% Quartz 30% Ca Carbonate 10% Mica 10.0% Non-fibrous (Other)	**None Detected**
25528-080725-129 *192506218-0129*	2' X 2' TEXTURED CEILING TILE WITH PINHOLES / LOWER LEVEL - WOMEN'S RESTROOM	Brown/Gray/White Fibrous Heterogeneous	25% Cellulose 20% MinWool	7% Mica 35% Perlite 13.0% Non-fibrous (Other)	**None Detected**
25528-080725-130 *192506218-0130*	2' X 2' TEXTURED CEILING TILE WITH PINHOLES / LOWER LEVEL - WOMEN'S RESTROOM	Brown/Gray/White Fibrous Heterogeneous	25% Cellulose 25% MinWool	5% Mica 35% Perlite 10.0% Non-fibrous (Other)	**None Detected**
25528-080725-131 *192506218-0131*	2' X 2' TEXTURED CEILING TILE WITH PINHOLES / LOWER LEVEL - WOMEN'S RESTROOM	Brown/Gray/White Fibrous Heterogeneous	25% Cellulose 25% MinWool	5% Mica 35% Perlite 10.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-132 *192506218-0132*	2' X 4' CEILING TILES WITH LARGE GOUGES AND POCKMARKS / LOWER LEVEL - OUTSIDE PARISH HALL	Brown/Gray/White Fibrous Heterogeneous	30% Cellulose 20% MinWool	5% Mica 35% Perlite 10.0% Non-fibrous (Other)	**None Detected**
25528-080725-133 *192506218-0133*	2' X 4' CEILING TILES WITH LARGE GOUGES AND POCKMARKS / LOWER LEVEL - ABOVE WOMEN'S RESTROOM DROP CEILING	Brown/Gray/White Fibrous Heterogeneous	30% Cellulose 20% MinWool	5% Mica 35% Perlite 10.0% Non-fibrous (Other)	**None Detected**
25528-080725-134 *192506218-0134*	2' X 4' CEILING TILES WITH LARGE GOUGES AND POCKMARKS / LOWER LEVEL - PARISH HALL	Brown/Gray/White Fibrous Heterogeneous	30% Cellulose 20% MinWool	5% Mica 35% Perlite 10.0% Non-fibrous (Other)	**None Detected**
25528-080725-135 *192506218-0135*	BROWN PIPE WRAP WITH ADHESIVE/ LOWER LEVEL - ABOVE WOMEN'S RESTROOM DROP CEILING	Brown/Black/Silver Fibrous Heterogeneous	35% Cellulose 30% Glass	35.0% Non-fibrous (Other)	**None Detected**
25528-080725-136 *192506218-0136*	BROWN PIPE WRAP WITH ADHESIVE/ LOWER LEVEL - ABOVE WOMEN'S RESTROOM DROP CEILING	Brown/Black Fibrous Heterogeneous	35% Cellulose 30% Glass	35.0% Non-fibrous (Other)	**None Detected**
25528-080725-137 *192506218-0137*	BROWN PIPE WRAP WITH ADHESIVE/ LOWER LEVEL - ABOVE WOMEN'S RESTROOM DROP CEILING	Brown/Black/Silver Fibrous Heterogeneous	40% Cellulose 25% Glass	35.0% Non-fibrous (Other)	**None Detected**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-138 *192506218-0138*	STAINED WINDOW GLAZING (INTERIOR) / FIRST LEVEL - WEST WALL (ACCESSIBLE WORKING WINDOW)	Gray/Tan/Black Non-Fibrous Heterogeneous		35% Ca Carbonate 65.0% Non-fibrous (Other)	**None Detected**
25528-080725-139 *192506218-0139*	STAINED WINDOW GLAZING (INTERIOR) / FIRST LEVEL - WEST WALL (ACCESSIBLE WORKING WINDOW)	Gray/Tan/Black Non-Fibrous Heterogeneous		30% Ca Carbonate 70.0% Non-fibrous (Other)	**None Detected**
25528-080725-140 *192506218-0140*	STAINED WINDOW GLAZING (INTERIOR) / FIRST LEVEL - WEST WALL (ACCESSIBLE WORKING WINDOW)	Gray/Tan/Black Non-Fibrous Heterogeneous	5% Synthetic	30% Ca Carbonate 65.0% Non-fibrous (Other)	**None Detected**
25528-080725-141 *192506218-0141*	STAINED WINDOW GLAZING (EXTERIOR) / FIRST LEVEL - WEST WALL (ACCESSIBLE WORKING WINDOW)	Gray/White/Black Fibrous Heterogeneous		35% Ca Carbonate 62.0% Non-fibrous (Other)	**3% Chrysotile**
25528-080725-142 *192506218-0142*	STAINED WINDOW GLAZING (EXTERIOR) / FIRST LEVEL - WEST WALL (ACCESSIBLE WORKING WINDOW)				**Positive Stop (Not Analyzed)**
25528-080725-143 *192506218-0143*	STAINED WINDOW GLAZING (EXTERIOR) / FIRST LEVEL - WEST WALL (ACCESSIBLE WORKING WINDOW)				**Positive Stop (Not Analyzed)**
25528-080725-144 *192506218-0144*	STAINED WINDOW FRAME CAULKING (EXTERIOR) / FIRST LEVEL - WEST WALL (ACCESSIBLE WORKING WINDOW)	Gray/Tan/Blue Fibrous Heterogeneous		35% Ca Carbonate 50.0% Non-fibrous (Other)	**15% Chrysotile**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
25528-080725-145 *192506218-0145*	STAINED WINDOW FRAME CAULKING (EXTERIOR) / FIRST LEVEL - WEST WALL (ACCESSIBLE WORKING WINDOW)				**Positive Stop (Not Analyzed)**
25528-080725-146 *192506218-0146*	STAINED WINDOW FRAME CAULKING (EXTERIOR) / FIRST LEVEL - WEST WALL (ACCESSIBLE WORKING WINDOW)				**Positive Stop (Not Analyzed)**

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed

EMSL Analytical, Inc.
10752 & 10768 Baltimore Avenue Beltsville, MD 20705
Tel/Fax: (301) 937-5700 / (301) 937-5701
http://www.EMSL.com / beltsvillelab@emsl.com

EMSL Order: 192506218
Customer ID: ADVA51
Customer PO:
Project ID:

Attention: Alex Fridman
Advanced Air Analysis, Inc
11 Warren Rd
Baltimore, MD 21208

Project: ST ELIZABETH CHURCH / 25528

Phone: (443) 829-5857
Fax: (410) 486-5200
Received Date: 08/08/2025 8:30 AM
Analysis Date: 08/12/2025 - 08/13/2025
Collected Date: 08/07/2025

The samples in this report were submitted to EMSL for analysis by Asbestos Analysis of Bulk materials via EPA/600 (0513) Method using Polarized Light Microscopy. The reference number for these samples is the EMSL Order ID above. Please use this reference number when calling about these samples.

Report Comments:

Sample Receipt Date:	08/08/2025	Sample Receipt Time:	8:30 AM
Analysis Completed Date:	08/13/2025	Analysis Completed Time:	6:48 AM

Analyst(s):

George Malone PLM (134)

Joe Centifonti PLM (65)

Samples Reviewed and approved by:

Emily C. Baker Asbestos Laboratory Manager
or other approved signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Report amended: 08/14/2025 12:03:56 Replaces initial report from: 08/13/2025 06:52:15 Reason Code: Data Entry-Samples Removed


AAA IH

Advanced Air Analysis Inc.

Aug 13, 2025 | 47 Photos

Advanced Air Analysis, Inc.
Environmental & Industrial Hygiene Consultants

St Elizabeth Church #25528

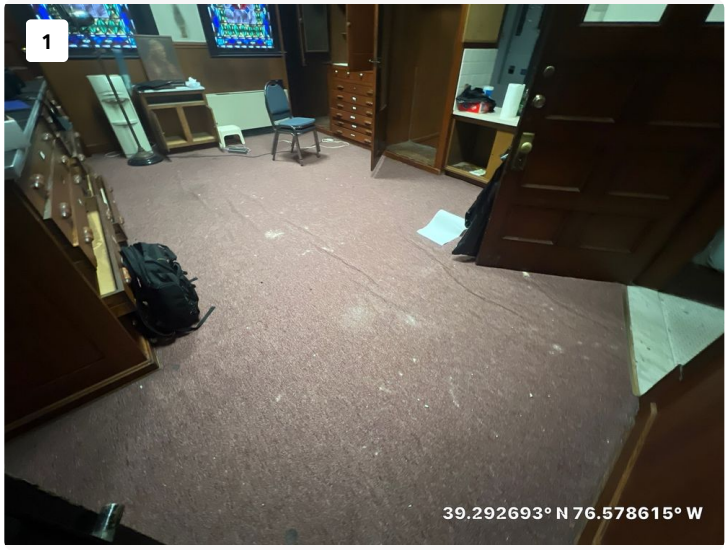

Carpet on padding not glued - First floor chapel east office


Project: St Elizabeth Church
Date: Aug 7, 2025, 8:57 AM
Creator: AAA IH



9" x 9" Red floor tiles with black mastic
25528-080725-58
First Level – chapel east office
25528-080725-59
First Level – chapel east office
25528-080725-60
First Level – chapel east office


9" x 9" Tan/gray floor tiles with black mastic

Project: St Elizabeth Church
Date: Aug 7, 2025, 8:59 AM
Creator: AAA IH

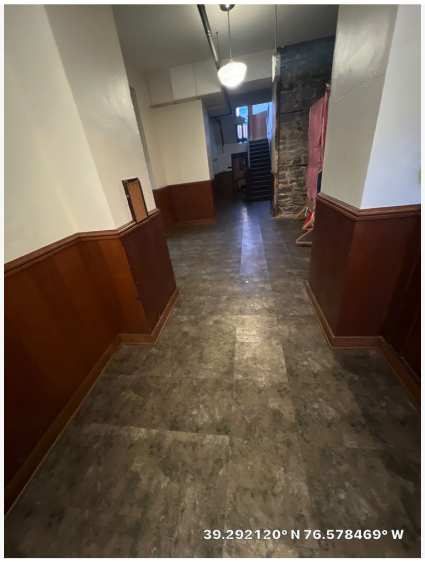

18" x 18" dark stone patterned floor tiles with gray adhesive
25528-080725-01
Lower Lever – parish hall stair area
25528-080725-02
Lower Lever – parish hall stair area
25528-080725-03
Lower Lever – parish hall stair area

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:35 AM
Creator: AAA IH

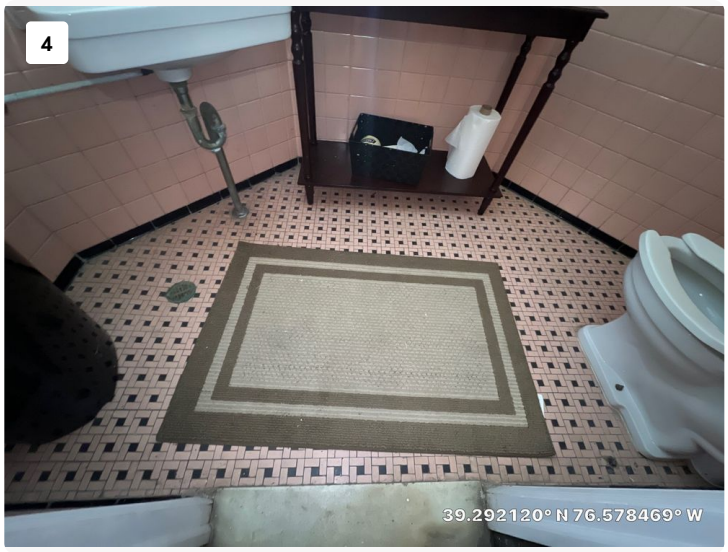

Ceramic tile grout
25528-080725-10
Lower Level – parish hall side kitchen/bar
25528-080725-11
Lower Level – parish hall men's restroom
25528-080725-12
Lower Level – parish hall women's. restroom

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:35 AM
Creator: AAA IH



18" x 18" dark stone patterned floor tiles with yellow adhesive
25528-080725-04
Lower Lever – parish hall main seating area outside restroom
25528-080725-05
Lower Lever – parish hall main seating area second column from restroom
25528-080725-06
Lower Lever – parish hall main seating area column in…

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:36 AM
Creator: AAA IH



12" x 12" tan with dark streaks floor tile and adhesive
25528-080725-13
Lower Level – parish hall stage
25528-080725-14
Lower Level – parish hall stage
25528-080725-15
Lower Level – parish hall stage

12" x 12" brown with white streaks floor tile and adhesive

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:38 AM
Creator: AAA IH




Drywall
25528-080725-114
Lower level – storage room between kitchen and mech room
25528-080725-115
Lower level – men's restroom
25528-080725-116
First Level – chapel east office

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:39 AM
Creator: AAA IH



Brown stairs flooring and adhesive
25528-080725-31
Lower Level – parish hall storage room of kitchen / mech room
25528-080725-32
Lower Level – parish hall storage room of kitchen / mech room
25528-080725-33
Lower Level – parish hall storage room of kitchen / mech room

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:39 AM
Creator: AAA IH

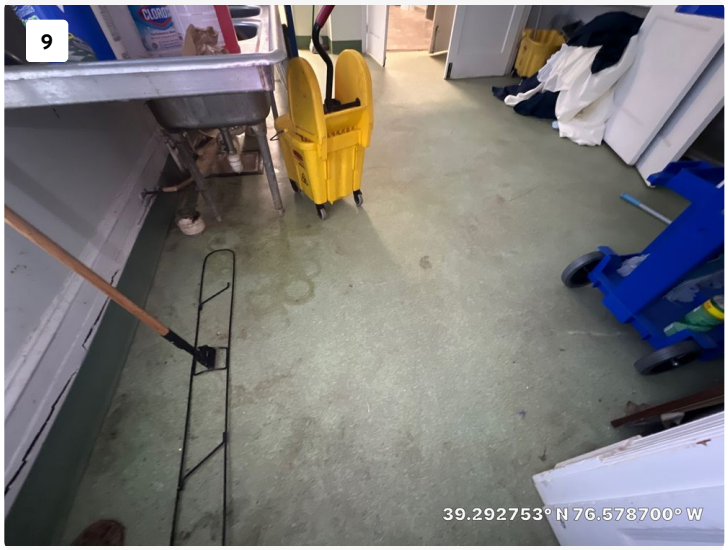

Green linoleum flooring with adhesive
25528-080725-19
Lower Level – parish hall kitchen
25528-080725-20
Lower Level – parish hall kitchen
25528-080725-21
Lower Level – parish hall kitchen

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:39 AM
Creator: AAA IH

10



Gray rubber stair tread mastic
25528-080725-34
Lower Level – parish hall center stairs landing
25528-080725-35
Lower Level – parish hall center stairs landing
25528-080725-36
Lower Level – parish hall center stairs

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:40 AM
Creator: AAA IH


11



Brown and white plaster walls
25528-080725-101
First Level – east side chapel next to statue
25528-080725-102
First Level – east side chapel next to statue
25528-080725-103
Lower Level – east wall
25528-080725-104
Lower Level – east wall
25528-080725-105

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:41 AM
Creator: AAA IH

12

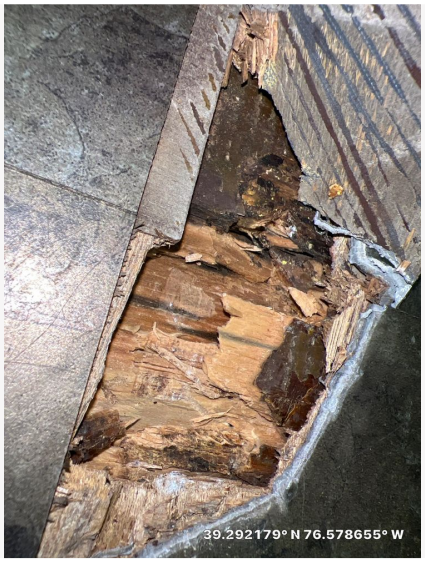

Brown layer between wood layers
25528-080725-07
Lower Level – parish hall outside men's restroom
25528-080725-08
Lower Level – parish hall center of parish hall
25528-080725-09
Lower Level – parish hall outside of kitchen

Project: St Elizabeth Church
Date: Aug 7, 2025, 9:57 AM
Creator: AAA IH



Yellow linoleum with adhesive under green linoleum
25528-080725-22
Lower Level – parish hall kitchen
25528-080725-23
Lower Level – parish hall kitchen
25528-080725-24
Lower Level – parish hall kitchen

Project: St Elizabeth Church
Date: Aug 7, 2025, 10:25 AM
Creator: AAA IH



Yellow linoleum with squares flooring and adhesive
ASBESTOS CONTAINING
25528-080725-25
Lower Level – parish hall storage room of kitchen / mech room
25528-080725-26
Lower Level – parish hall storage room of kitchen / mech room
25528-080725-27
Lower Level – parish hall storage room of kitchen / mech room

Project: St Elizabeth Church
Date: Aug 7, 2025, 10:27 AM
Creator: AAA IH



Cove base and tan adhesive
25528-080725-40
Lower Level – parish hall outside of side kitchen/bar
25528-080725-41
Lower Level – parish hall outside of men's restroom
25528-080725-42
Lower level – parish hall center of space on column

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:05 AM
Creator: AAA IH



Cove base and brown adhesive
25528-080725-43
Lower Level – parish hall side kitchen/bar
25528-080725-44
Lower Level – parish hall side kitchen/bar
25528-080725-45
Lower Level – parish hall side kitchen/bar

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:06 AM
Creator: AAA IH



Assume ACM - adhesive behind wood accents

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:06 AM
Creator: AAA IH



Terrazzo flooring
25528-080725-46
First Level – south entrance corridor
25528-080725-47
First Level – south entrance corridor
25528-080725-48
First Level – south entrance corridor
Suggest TEM Upgrade for Sample #
48 was declined by Client

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:18 AM
Creator: AAA IH



Yellow carpet glue
25528-080725-49
First Level – south entrance corridor
25528-080725-50
First Level – south entrance corridor
25528-080725-51
First Level – south entrance corridor

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:20 AM
Creator: AAA IH




12" x 12" Blue mottled floor tiles with adhesive
25528-080725-52
First Level – chapel
25528-080725-53
First Level – chapel
25528-080725-54
Second Level – organ/piano room

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:21 AM
Creator: AAA IH




Brown carpet glue
25528-080725-55
First Level – alter carpet
25528-080725-56
First Level – alter carpet
25528-080725-57
First Level – alter carpet

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:28 AM
Creator: AAA IH

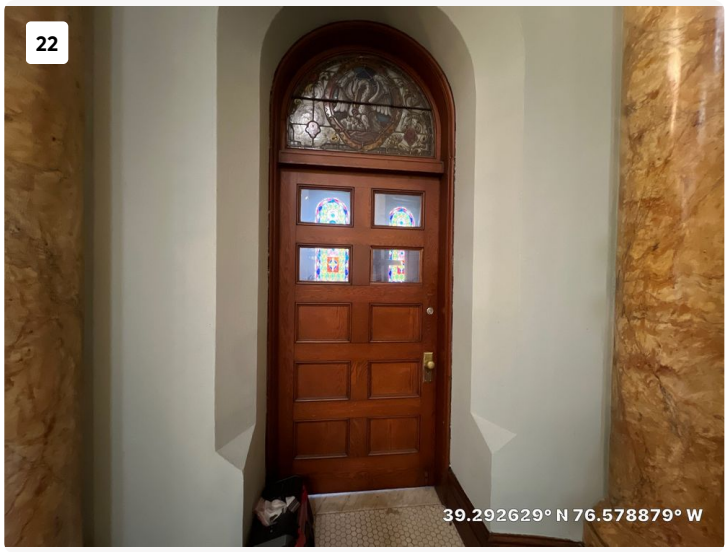


West chapel office - Inaccessible

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:33 AM
Creator: AAA IH

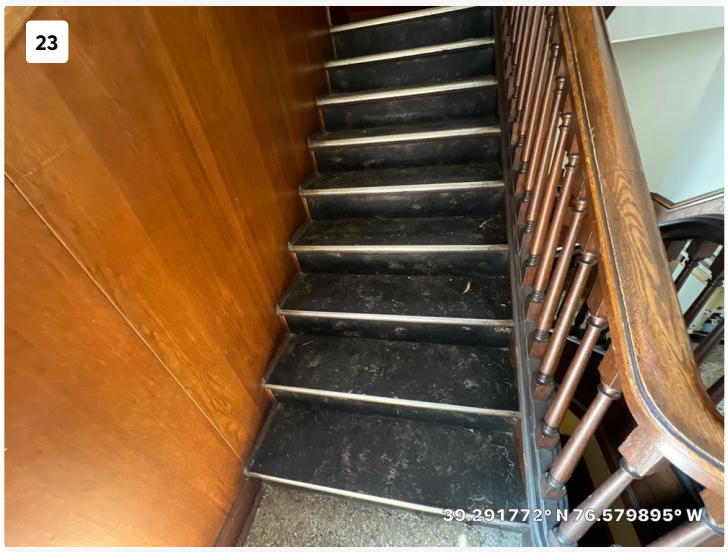

Black stairs flooring with adhesive
25528-080725-67
First Level – south entrance stairs to second floor
25528-080725-68
First Level – south entrance stairs to second floor
25528-080725-69
First Level – south entrance stairs to second floor

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:36 AM
Creator: AAA IH

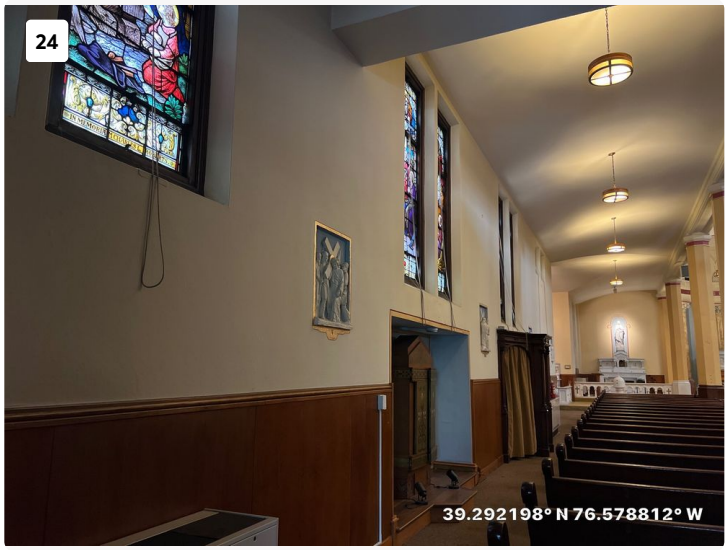

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:46 AM
Creator: AAA IH

25



Textured ceiling (popcorn ceiling)
25528-080725-120
First Level – south entrance corridor
25528-080725-121
First Level – south entrance corridor
25528-080725-122
First Level – south entrance corridor

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:46 AM
Creator: AAA IH

26



Project: St Elizabeth Church
Date: Aug 7, 2025, 11:48 AM
Creator: AAA IH

27



Repair tiles: 12" x 12" tan mottled floor tiles with adhesive
25528-080725-70
Second Level - organ/piano room
25528-080725-71
Second Level - organ/piano room
25528-080725-72
Second Level - organ/piano room
ASBESTOS CONTAINING

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:49 AM
Creator: AAA IH

28



9" x 9" Dark gray floor tiles with black mastic
25528-080725-73
Second Level - organ/piano room
25528-080725-74
Second Level - organ/piano room
25528-080725-75
Second Level - organ/piano room
ASBESTOS CONTAINING


Project: St Elizabeth Church
Date: Aug 7, 2025, 11:49 AM
Creator: AAA IH

29




Project: St Elizabeth Church
Date: Aug 7, 2025, 11:49 AM
Creator: AAA IH

30

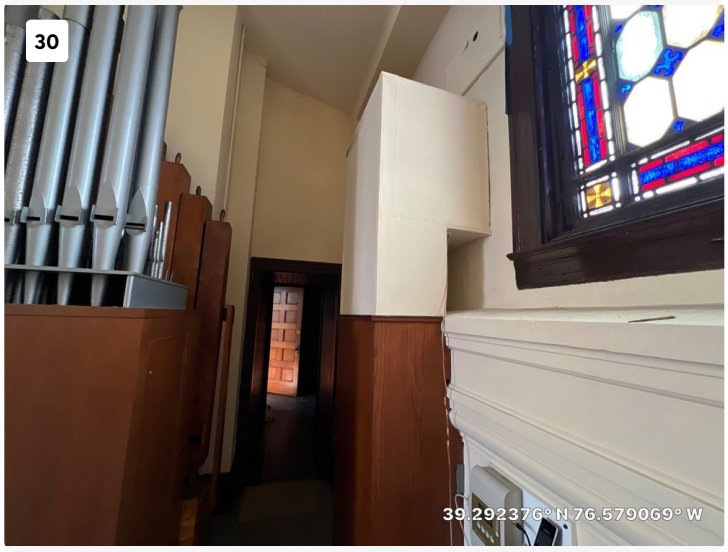

Fiberglass insulation Ductwork wrap with sealant
25528-080725-85
Second Level – room next to organ/piano room
25528-080725-86
Second Level – room next to organ/piano room
25528-080725-87
Second Level – room next to organ/piano room

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:50 AM
Creator: AAA IH

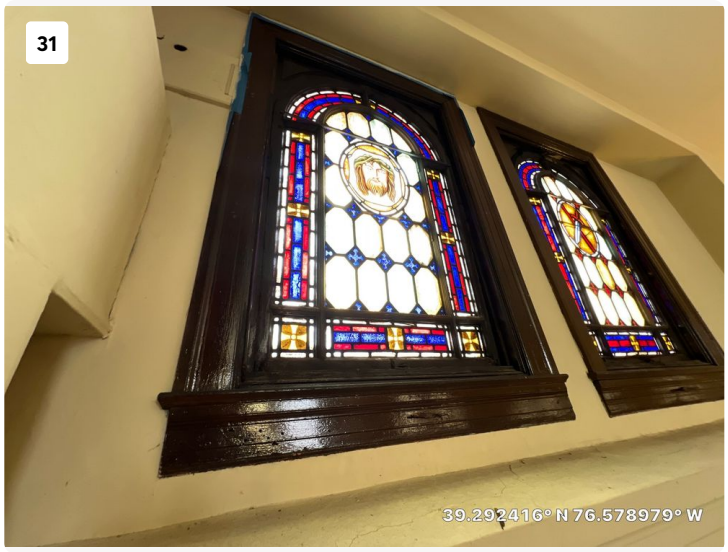

Project: St Elizabeth Church
Date: Aug 7, 2025, 11:50 AM
Creator: AAA IH



Yellow carpet glue(powder)
25528-080725-76
Second Level - organ/piano room
25528-080725-77
Second Level - organ/piano room
25528-080725-78
Second Level - organ/piano room

Project: St Elizabeth Church
Date: Aug 7, 2025, 12:11 PM
Creator: AAA IH



Vapor barrier paper
25528-080725-79
Second Level – room next to organ/piano room
25528-080725-80
Second Level – room next to organ/piano room
25528-080725-81
Second Level – room next to organ/piano room

Project: St Elizabeth Church
Date: Aug 7, 2025, 12:16 PM
Creator: AAA IH



Gray floor leveler with black spots
25528-080725-82
Second Level – room next to organ/piano room
25528-080725-83
Second Level – room next to organ/piano room
25528-080725-84
Second Level – room next to organ/piano room

Project: St Elizabeth Church
Date: Aug 7, 2025, 12:16 PM
Creator: AAA IH




Gray and white plaster walls
25528-080725-88
Second Level - organ/piano room
25528-080725-89
Second Level – room next to organ/piano room
25528-080725-90
First Level – west side chapel
25528-080725-91
First Level – east side chapel office
25528-080725-92

Project: St Elizabeth Church
Date: Aug 7, 2025, 12:22 PM
Creator: AAA IH



Textured plaster wall covering
25528-080725-98
First Level – east side chapel office
25528-080725-99
First Level – east side chapel office
25528-080725-100
First Level – east side chapel office

Project: St Elizabeth Church
Date: Aug 7, 2025, 12:32 PM
Creator: AAA IH

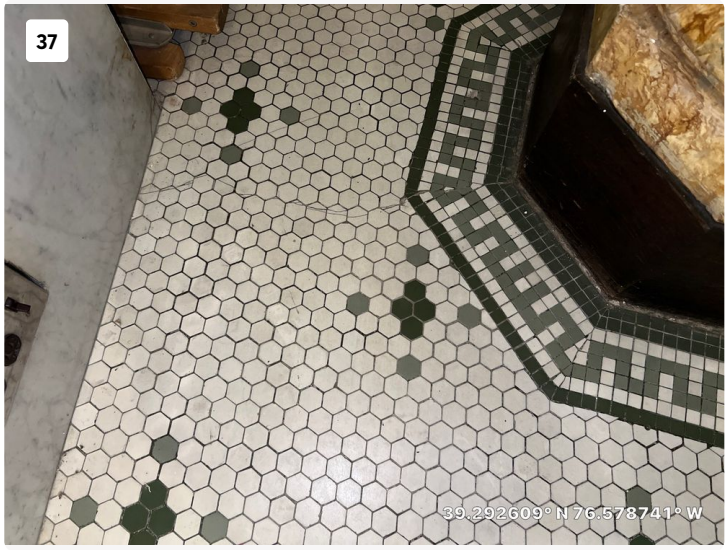

Tile grout
25528-080725-64
First Level – chapel alter east
25528-080725-65
First Level – chapel alter north
25528-080725-66
First Level – chapel alter west

Project: St Elizabeth Church
Date: Aug 7, 2025, 12:35 PM
Creator: AAA IH



Plaster
25528-080725-108
Lower level – columns
25528-080725-109
Lower level – columns
25528-080725-110
Lower level – columns

Project: St Elizabeth Church
Date: Aug 7, 2025, 12:52 PM
Creator: AAA IH



Black ductwork panel covering
25528-080725-111
Lower level – next to women's restroom
25528-080725-112
Lower level – next to women's restroom
25528-080725-113
Lower level – next to women's restroom

Project: St Elizabeth Church
Date: Aug 7, 2025, 12:57 PM
Creator: AAA IH



2′ x 4′ ceiling tile with pinoles and pockmarks
25528-080725-123
First Level – chapel east office
25528-080725-124
First Level – chapel east office
25528-080725-125
First Level – chapel east office

Project: St Elizabeth Church
Date: Aug 7, 2025, 1:54 PM
Creator: AAA IH



Plaster ceiling
25528-080725-126
First Level – chapel east office
25528-080725-127
First Level – chapel east office
25528-080725-128
First Level – chapel east office

Project: St Elizabeth Church
Date: Aug 7, 2025, 1:56 PM
Creator: AAA IH



2′ x 4′ ceiling tile with large gouges and pockmarks
25528-080725-132
Lower level – outside parish hall
25528-080725-133
Lower Level – above women's restroom drop ceiling
25528-080725-134
Lower Level – parish hall

Project: St Elizabeth Church
Date: Aug 7, 2025, 2:11 PM
Creator: AAA IH



2′ x 2′ textured ceiling tile with pinoles
25528-080725-129
Lower level – women's restroom
25528-080725-130
Lower level – women's restroom
25528-080725-131
Lower level – women's restroom

Project: St Elizabeth Church
Date: Aug 7, 2025, 2:11 PM
Creator: AAA IH



Brown pipe wrap with adhesive
25528-080725-135
Lower Level – above women's restroom drop ceiling
25528-080725-136
Lower Level – above women's restroom drop ceiling
25528-080725-137
Lower Level – above women's restroom drop ceiling

Project: St Elizabeth Church
Date: Aug 7, 2025, 2:22 PM
Creator: AAA IH



Stained window glazing (interior)
25528-080725-138
First Level – west wall (accessible working window)
25528-080725-139
First Level – west wall (accessible working window)
25528-080725-140
First Level – west wall (accessible working window)

Project: St Elizabeth Church
Date: Aug 7, 2025, 3:29 PM
Creator: AAA IH

46



Stained window glazing (exterior)
25528-080725-141
First Level – west wall (accessible working window)
25528-080725-142
First Level – west wall (accessible working window)
25528-080725-143
First Level – west wall (accessible working window)
ASBESTOS CONTAINING

Project: St Elizabeth Church
Date: Aug 7, 2025, 3:29 PM
Creator: AAA IH

47



Stained window frame caulking (exterior)
25528-080725-144
First Level – west wall (accessible working window)
25528-080725-145
First Level – west wall (accessible working window)
25528-080725-146
First Level – west wall (accessible working window)
ASBESTOS CONTAINING

Project: St Elizabeth Church
Date: Aug 7, 2025, 3:29 PM
Creator: AAA IH

ADVANCED AIR ANALYSIS, INC.


DAILY LOG

CLIENT: Bluebird Education Network
CLIENT #
JOB SITE: St Elizabeth Church
JOB # 25528
ADDRESS: 2700 E Baltimore St Baltimore, MD, United States
CONTRACTOR: N/A
IH: Carlos Rivera, Vadim Fridman
DATE: 08/07/25

TIME	ACTIVITY/DESCRIPTION
832	AAA on site and met with Mr. Bob Proutt, He escorted us in tho the church - chapel and began walk through of the church
	to confirm scope of work
Scope of work	AAA will inspect and collect suspect ACM bulk samples, throughout the church (3 levels)
	AAA will also collect XRF screening readings on suspect lead based paint.
950	AAA began inspection/sampling
Notes*	9" x 9" floor tiles with associated black mastic:
	Lower level Closet outside Men's restroom: ~8 SF, First level in chapel east office: ~300 SF.
	Second level hallway to organ/piano room: ~10 SF,
	Assuming there could be layers of suspect ACM flooring under Hardwood floor in chapel area.
	Interior stained glass window materials were sampled, as they will be removed and reused.
	Storm windows wont be disturbed. According to Mr. Proutt.
	See materials list for all materials sampled/assumed suspect to AAA.
1600	AAA completed inspection, IH off site.

SIGNATURE: 

Asbestos Accreditation

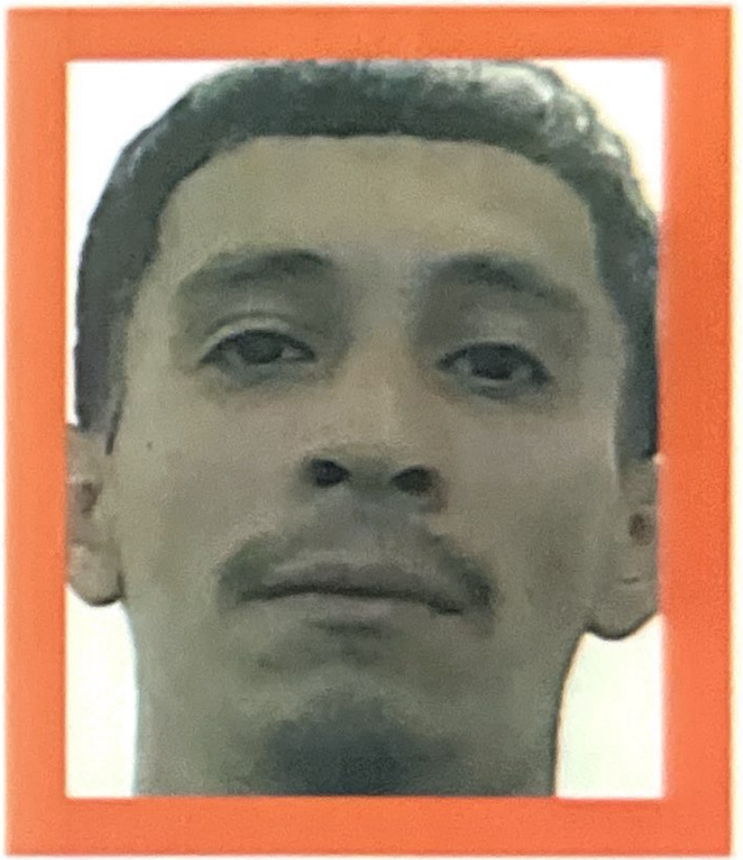

Carlos Rivera Anaya

Name

Signature

Inspector Review

Course Title

240002635

Exam Date: 12/06/2024

Course Date: 10/18/2024

Exp Date: 10/18/2025

STATE OF MARYLAND